

SIEMENS



User Guide

My SINUMERIK Operate

Contents

- 1 Introduction 9
- 2 SINUMERIK Operate 11
 - 2.1 Uniform user interface for turning and milling..... 12
 - 2.2 Help screens, animated elements, graphic view, tooltips, help..... 16
 - 2.3 TSM-mode/zero offsets 18
 - 2.4 Logging measurement results in JOG (standard log)..... 19
 - 2.5 Retraction..... 22
 - 2.6 Tool management 23
 - 2.7 Zero offset..... 27
 - 2.8 User variables 28
 - 2.9 Program management..... 29
 - 2.10 Programming 33
 - 2.11 DXF Reader..... 39
 - 2.12 Execution from external storage (EES)..... 45
 - 2.13 Workpiece visualization 46
 - 2.14 CNC operation in Automatic mode (AUTO) 48
 - 2.15 Logging measurement results in the automatic mode..... 52
 - 2.16 Collision Avoidance..... 54

3 Turning technology 57

3.1 Setting up	58
3.1.1 Setting the zero point.....	58
3.1.2 Workpiece zero	59
3.1.3 Tool measurement	59
3.2 Manual Machine	62
3.3 Programming.....	64
3.3.1 ShopTurn.....	64
3.3.2 programGUIDE	66
3.4 Drilling	68
3.4.1 Overview of drilling cycles	68
3.4.2 Drilling centered/off-centered with ShopTurn	73
3.4.3 Drilling with programGUIDE	74
3.5 Turning.....	76
3.5.1 Overview of the turning cycles.....	76
3.6 Contour turning	79
3.6.1 Overview of the turning cycles for the contour machining	79
3.6.2 Contour turning with ShopTurn machining step programming	80
3.6.3 Contour turning with programGUIDE.....	82
3.7 Milling	88
3.7.1 Overview of the milling cycles.....	88
3.8 Contour milling.....	91
3.8.1 Overview of the milling cycles for the contour machining.....	91
3.8.2 Contour milling with ShopTurn machining step programming	93
3.8.3 Contour milling with programGUIDE	95
3.9 Counterspindle	98
3.10 Measuring in the Automatic mode - in-process measurement	99
3.10.1 Measure workpiece	99
3.10.2 Example.....	100

4 Milling technology	103
4.1 Setting up	104
4.1.1 Setting the zero point.....	104
4.1.2 Workpiece zero	105
4.1.3 Tool measurement	106
4.1.4 Face milling	106
4.1.5 Swiveling in JOG	107
4.2 Manual Machine	108
4.3 Programming	109
4.3.1 ShopMill machining step programming	109
4.3.2 programGUIDE (G-Code).....	111
4.4 Drilling cycles	113
4.5 Milling cycles	117
4.6 Contour milling	121
4.6.1 Overview of the milling cycles for the contour machining.....	121
4.6.2 Contour milling with ShopMill machining step programming	123
4.6.3 Contour milling with programGUIDE (G-Code)	125
4.7 Miscellaneous	128
4.8 Measuring in the Automatic mode – in-process measurement	135
4.8.1 Measure workpiece	135
4.8.2 Measure tool	137

5 Multitasking (with SINUMERIK 840D sl)	139
5.1 Tool management	140
5.2 Turning-milling technology with ShopTurn and programGUIDE	141
5.2.1 Swivel axis in TSM-mode	141
5.2.2 Turning with ShopTurn and B axis	141
5.2.3 Turning with programGUIDE and B axis	142
5.2.4 Milling with ShopTurn and B axis	142
5.2.5 Milling with programGUIDE and B axis	144
5.3 Milling-turning technology with ShopMill and programGUIDE	146
5.3.1 TSM-mode	146
5.3.2 Tool measuring	147
5.3.3 Face milling/stock removal	148
5.3.4 Overview of the turning cycles in the milling technology	149
5.3.5 Contour turning in the milling technology	152
5.3.5.1 Overview of the contour turning cycles	152
5.3.5.2 Contour turning with programGUIDE in the milling technology	154
5.3.5.3 Contour turning with ShopMill when milling	158
5.4 Multi-channel machining	160
5.4.1 Machine basic screen	160
5.4.2 programSync multi-channel	161
5.4.3 Multi-channel program data	162
5.4.4 Dual editor	162
5.4.5 Time synchronization	163
5.4.6 Synchronous view	164
5.4.7 Simulation	164
5.4.8 Determining the machining time, optimization	165
5.4.9 Program control	166
6 Appendix	169
6.1 G-Code	169
6.2 Shortcuts	170
6.3 Gesture control – Smart Operate	173
6.4 Further information	174
7 Index	177

1 Introduction

The SINUMERIK Operate user interface provides a clear and intuitive user and programming interface. This provides a uniform look & feel not only for turning and milling but also the connection of machining step and high-level language programming under a single system user interface. SINUMERIK Operate V4.7 also brings new, powerful functions.



This user guide provides you with an overview of the range of functions of SINUMERIK Operate and gives you useful tips and tricks for your daily work. In addition to the SINUMERIK Operate chapter – with general operating tips – the other chapters give practical expert knowledge for the milling, turning and working with multitasking machines. The appendix contains an overview of the SINUMERIK Operate shortcuts and an overview of G code commands.

2 SINUMERIK Operate

SINUMERIK Operate has a uniform operating and programming interface with powerful functions for turning and milling. The functions and operating instructions described in this chapter therefore apply irrespective of whether you work on a turning or a milling machine or at a machining center.



2.1 Uniform user interface for turning and milling


SINUMERIK Operate has a uniform operating and programming interface with powerful functions for turning and milling. The functions and operating instructions described in this chapter therefore apply irrespective of whether you work on a turning or a milling machine or at a machining center.

- HMI-Advanced, ShopMill and ShopTurn combined under a single interface
- Intuitive and clear operation and programming, including animated elements
- Representation in the modern Windows style
- New powerful functions ...
 - Setup, programming, tool and program management
 - for complete machining
 - Multi-channel capability with ShopTurn for multi-channel machines, among other things, synchronization of programs with programSYNC and much more...
- CNC programming for the highest level of productivity using programGUIDE
- Machining step programming for the shortest programming time with ShopMill and ShopTurn


The following overview provides an initial introduction to the look & feel of SINUMERIK Operate:

Setting-up operation


A single user interface for almost all SINUMERIK controllers ...

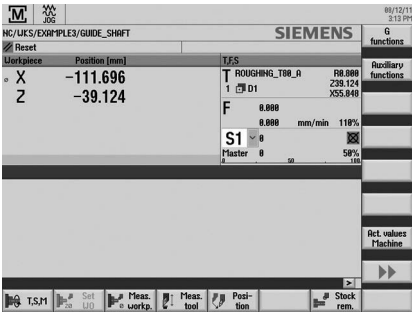

Turning

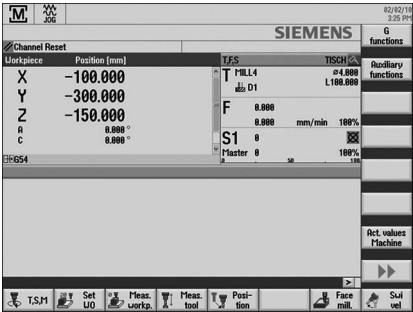


Milling

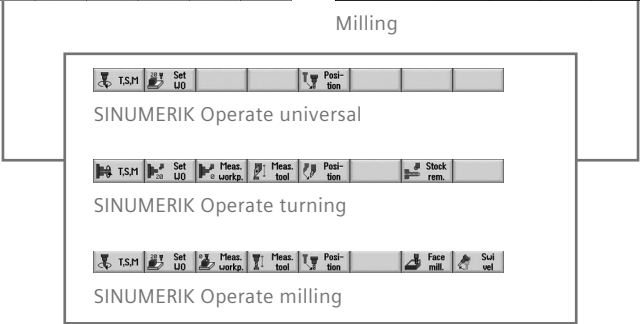


Tool management

Efficient management of the tool data including all details and sister tool handling ...

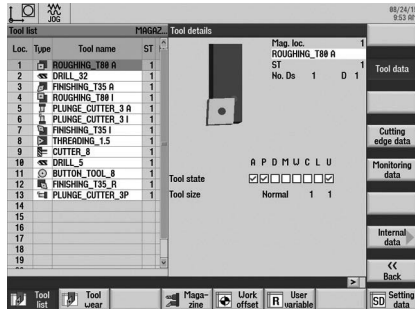


Turning

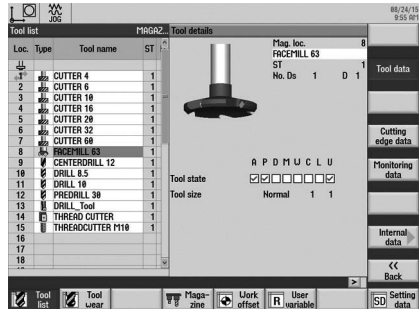


Milling

Program manager

Time savings thanks to user-friendly data transmission and simple program handling ...

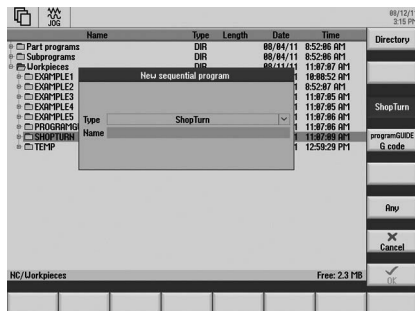


Turning

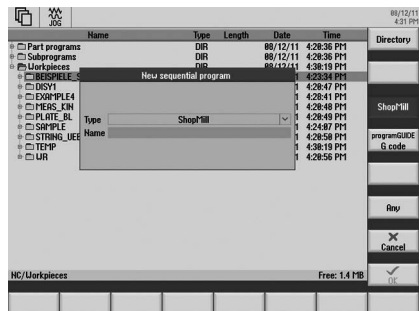


Milling



Backing up
setup data ...

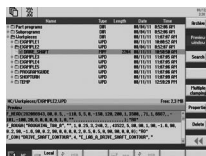


Preview window ...

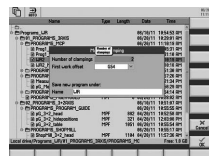


Multiple clamping for
ShopMill ...

programGUIDE

Maximum productivity and flexibility in the programming combined with innovative technology and machining cycles ...

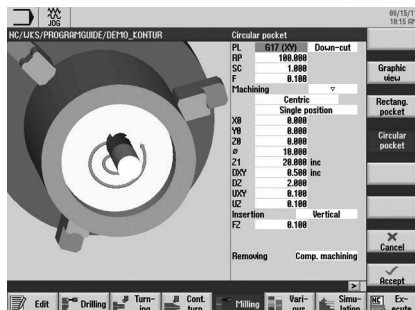


Turning

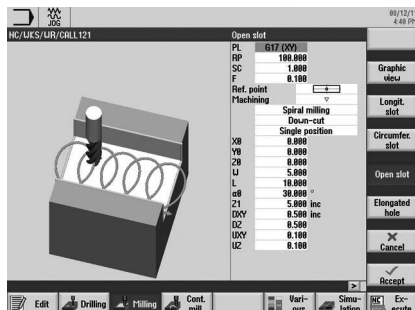

Milling

ShopTurn/ShopMill

In addition to programGUIDE, ShopTurn/ShopMill offers the unique machining step programming to achieve the shortest programming times in the single-part production.

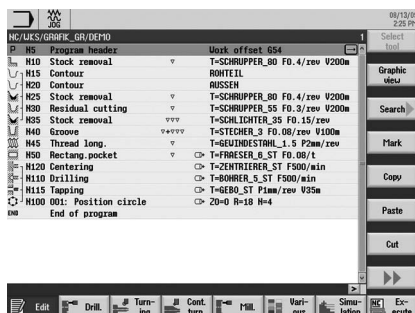


Turning




Milling

2.2 Help screens, animated elements, graphic view, tooltips, help

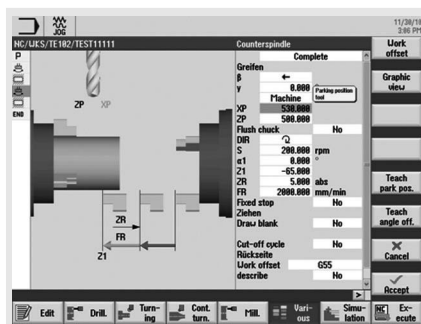

Help screens ...


A help screen is displayed for each machining cycle. The current parameter is color-high-lighted in the help screen.

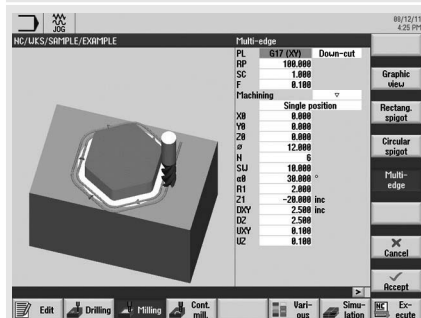

Animated elements ...

Animated elements help you for the parameterization of cycles with intuitive animation of the motion sequences.


The animation starts automatically after a few seconds.

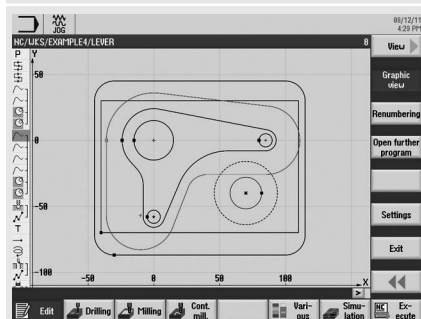


Graphic view


The "Graphic view" softkey can be used to change to the individual cycle screens or to call the broken-line graphics for the complete workpiece.

⇒ **Ctrl+G shortcut**

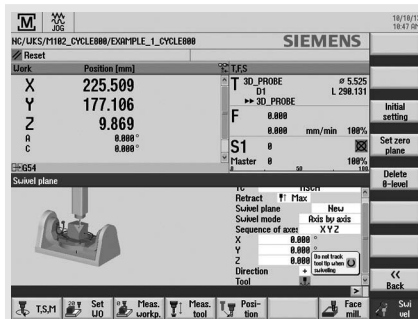



A tooltip is displayed for each input field. Selection fields are indicated with the additional  symbol in the tooltip.

If an entered value is not permitted, the tooltip and the input field are displayed in red font and with a red background, respectively.

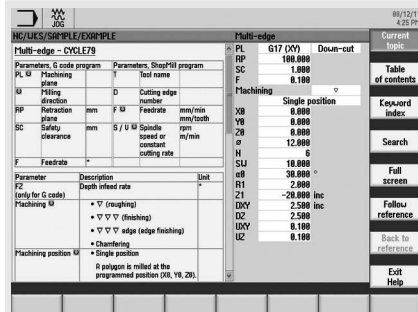

The "Help" key fetches the context-sensitive help that can be used in all screens (also in the machine data area).

2.3 TSM-mode/zero offsets


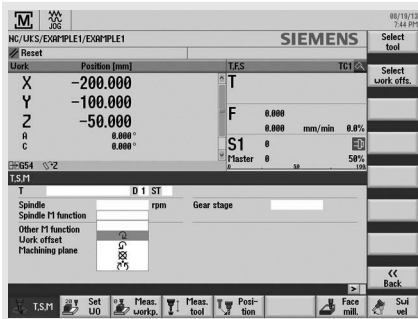


In TSM cycle (manual mode), you can, among other things,

- perform a tool change (T) also with spare tool, with direct access from the tool table,
- define the spindle speed and direction (S),
- enter M functions (M),
- activate zero offsets,
- select the machining plane,
- specify the gear stage.



For selection fields, such as Spindle M function or Machining plane, you can use the “Select” key to make a selection; clicking any button opens the list.

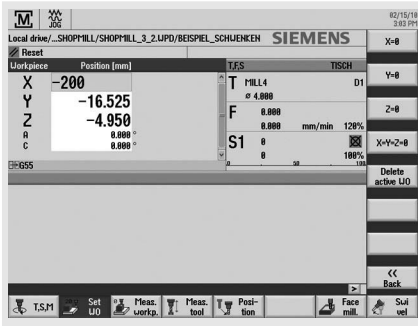


In the “Set ZO” dialog box, you can write direct position values for individual axes in the actual value display.

The difference between the position value in the machine coordinate system (MCS) and the workpiece coordinate system (WCS) is saved in the active zero offset.

■ **Note:** More information about setup functions in JOG and for in-process measurements can be found in the appropriate chapters for turning or milling.


2.4 Logging measurement results in JOG (standard log)

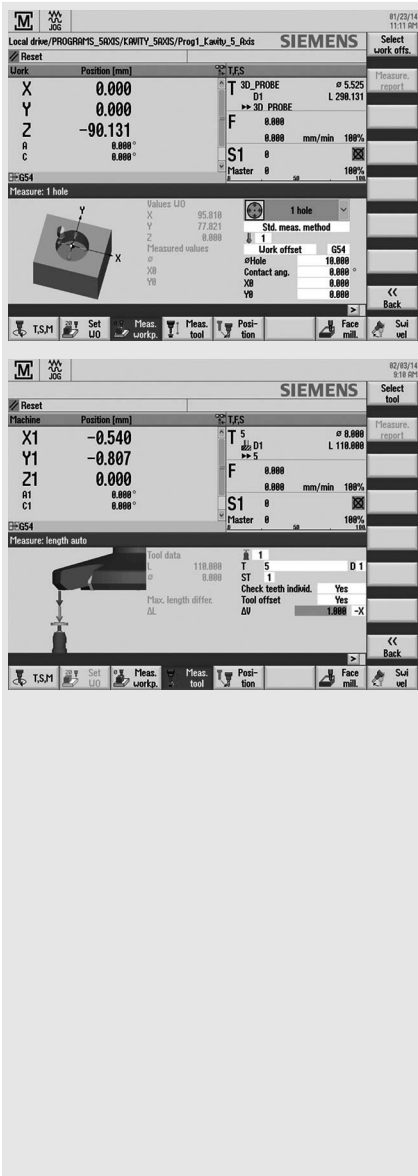

The results when making measurements in JOG can be logged: At the end of the measuring operation, the “Measurement log” softkey is displayed for this purpose.

A standard protocol is automatically created by pressing the softkey. This contains the measurement results of the last measurement version executed.

For milling, the function is available for measuring the workpiece and tool, for turning, for measuring the tool.

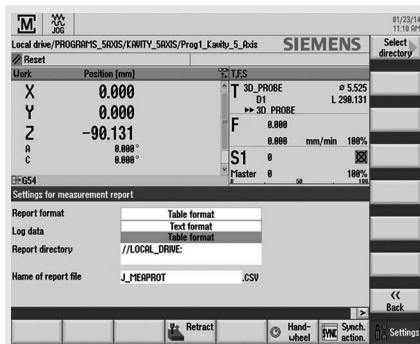

Settings



Measure report

You can configure the output in the “Settings for the measurement log” screen form. The following settings are possible:

Protocol format:

- Text format (*.txt)
- Table format (*.csv)

Log data:


- New (reject old log data)
- Attach (attach to old log data)

Log archive:

- Archive directory (complete path)

Log file name:

- Log file name (file extension corresponding to what was selected under the log format)

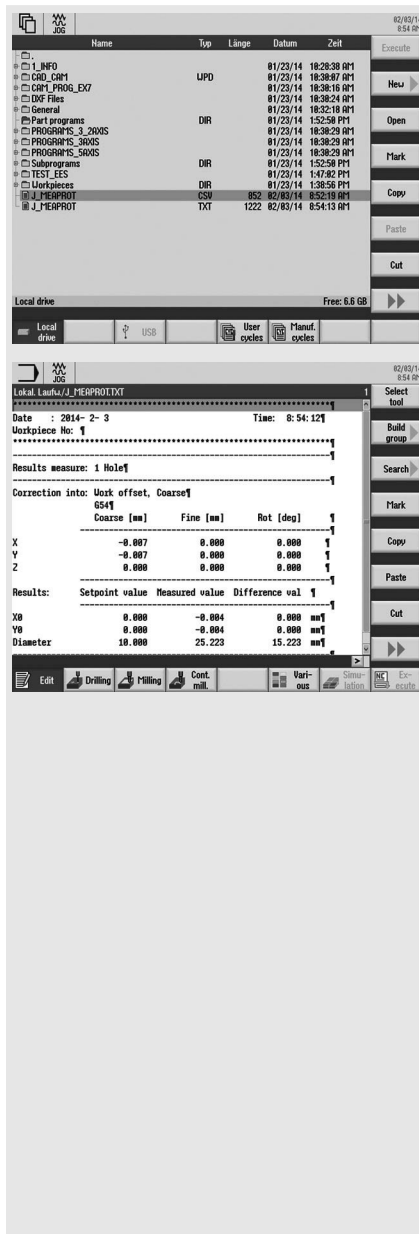


Open the measurement log in program management under the configured archive path.

The measurement log always includes the following data:

- Date and time when the log was written to
- Log name with path
- Measurement version
- Correction target
- Setpoints, measured values and differences

Note: The measurement protocols are output in English, independently of the interface language.

2.5 Retraction

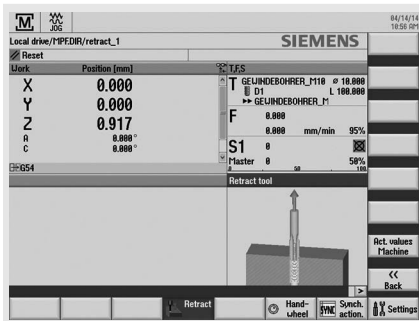

The “Retract” function allows the tool to be manually retracted after an interruption as a result of power failure. In the JOG mode, after the interruption, the tool can be retracted from the workpiece in the tool direction. Typical applications include machining operations, using swivel cycle CYCLE800, 5-axis machining operations with TRAORI as well as tapping without compensating chuck. When a thread tapping tool is retracted, the spindle direction of rotation and linear motion is interpolated in the retraction direction so that the thread is not damaged.

This means that machining can be continued at the point of interruption.

2.6 Tool management

[illegible]

Tools with the same name are created as sister tools. In the ST column (ST = Sister tool), the sister tools are identified with an incrementing number.


The screenshot shows the 'MAGAZ' tool list and details in a CAD software interface. The 'Tool list' table on the left contains the following data:

Loc.	Type	Tool name	ST
1	ROUGHING	T88_R	1
2	DRAWILL	32	1
3	FINISHING	T35_R	1
4	ROUGHING	T88_L	1
5	PLUNGE CUTTER	3_A	1
6	PLUNGE CUTTER	31	1
7	FINISHING	T35	1
8	THREADING	1.5	1
9	CUTTER	8	1
10	DRAWILL	5	1
11	BUTTON TOOL	8	1
12	FINISHING	T35_R	1
13	PLUNGE CUTTER	3P	1

The 'Tool details' panel on the right shows the selected tool 'Plunge Cutter 3' with the following parameters:


- Phs. Inc. THREADING_1.5 1 8
- ST
- No. Ds 1 1 D 1

Below the parameters, there is a 3D model of the tool. To the right of the model, the 'Tool data' section includes 'Cutting edge data' and 'Monitoring data' (with checkboxes for A, P, O, M, U, C, L, U). The 'Tool size' section shows 'Normal 1 1'. At the bottom, there are tabs for 'Tool list', 'Tool user', 'Flange', 'Work culture', 'R', 'User', and 'Machine', along with a 'SD' button and a 'Setting' button.




Tools with their complete operating data can be managed in the tool list. This includes:

- The tool type (displayed as an icon)
- The unique tool name (max. 24 characters)
- Number of cutting edges per tool (max. 9)
- Tool length and diameter and/or cutting plate geometry
- Nose angle for drills or number of teeth for milling tools
- Direction of spindle rotation and coolant (level 1 and 2)



You can view the tool details, such as tool status, using the “Details” softkey. The tool is displayed graphically.

Loc	FIT LO	Type	Tool name	ST	D	ΔLength X	ΔLength Z	ΔRadius T	Magazine
1/1			ROUGHING_T00_R	1	1	0.000	0.000	0.000	
1/2			DRILL_32	1	1	0.000	0.000	0.000	
1/3			FINISHING_T35_R	1	1	0.000	0.000	0.000	
1/4			ROUGHING_T00_L	1	1	0.000	0.000	0.000	
1/5			PLUNGE_CUTTER_3_R	1	1	0.000	0.000	0.000	
1/6			PLUNGE_CUTTER_3_L	1	1	0.000	0.000	0.000	
1/7			FINISHING_T35_L	1	1	0.000	0.000	0.000	
1/8			THREAD_15	1	1	0.000	0.000	0.000	
1/9			CUTTER_8	1	1	0.000	0.000	0.000	
1/10			DRILL_5	1	1	0.000	0.000	0.000	
1/11			BUTTON_TOOL_8	1	1	0.000	0.000	0.000	
1/12			THREADCUTTER_M6	1	1	0.000	0.000	0.000	
1/13			DRILL_10	1	1	0.000	0.000	0.000	
1/14									
1/15									
1/16									
2/1									
2/2									
2/3									



The tool wear list contains all the information required during operation.




You can automatically monitor the tools' working times via the workpiece count, tool life or wear.

In addition, you can disable tools when you no longer wish to use them.

The following overview shows the used symbols and explains the tool status:


Icon/Designation	Meaning
Red "X"	The tool is disabled.
Yellow triangle pointing downward	The prewarning limit has been reached.
Yellow triangle pointing upward	The tool is in a special state. Place the cursor on the marked tool. A tooltip provides a short description.
Green border	The tool is preselected.

Magazine/location number	Meaning
Green double arrow	The magazine location is positioned at the change position.
Gray double arrow (configurable)	The magazine location is positioned at the loading position.
Red "X"	The magazine location is disabled.

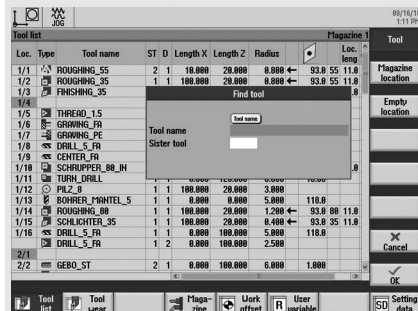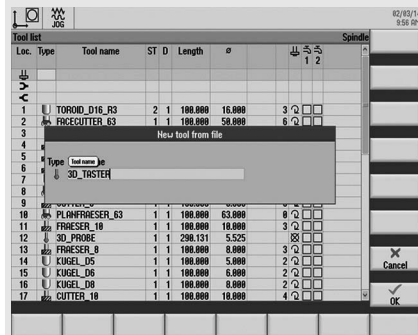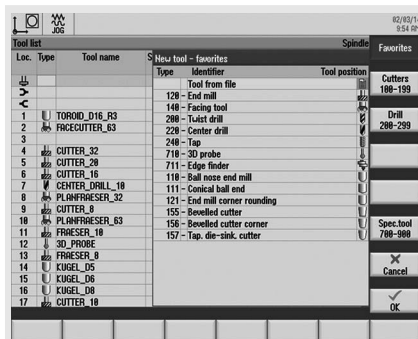


When creating new tools, you can select the required tool from transparent tables for the particular tool types. For example, favorites are combined in a separate table. In the table listing the favorites, you can import a tool using the "Tool from file" entry (see Tool list -> Settings).

It is also possible to create a multitool when using a milling spindle or a double tool holder.

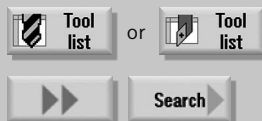


Click the "Find" softkey to open the tool search. You can search for tools, magazine locations or empty locations.

➔ *Ctrl+F shortcut*

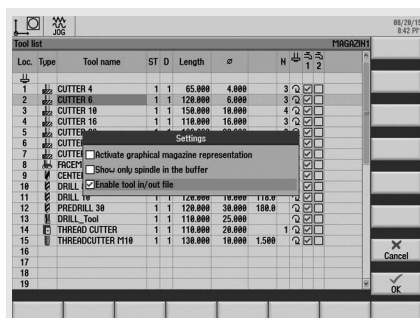

The screenshot shows a software interface with a 'Tool list' table and a 'Settings' dialog box. The 'Tool list' table has columns: Loc, Type, Tool name, ST, D, Length, σ , N, and a set of checkboxes. The 'Settings' dialog box is open, showing options: 'Activate graphical magazine representation' (checked), 'Show only spindle in the buffer' (checked), and 'Enable tool in/out file' (checked). The 'Cancel' button is visible at the bottom right of the dialog.


Loc	Type	Tool name	ST	D	Length	σ	N	1	2
1		CUTTER 4	1	1	65.000	4.000	3	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
2		CUTTER 6	1	1	128.000	6.000	3	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
3		CUTTER 10	1	1	158.000	10.000	4	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
4		CUTTER 16	1	1	110.000	16.000	3	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
5		CUTTER 25	1	1	110.000	25.000	3	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
6		CUTTER 32	1	1	110.000	32.000	3	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
7		CUTTER 40	1	1	110.000	40.000	3	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
8		FACE MILL	1	1	128.000	128.000	3	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
9		CENTER	1	1	110.000	110.000	3	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
10		DRILL	1	1	110.000	110.000	3	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
11		DRILL 10	1	1	128.000	18.000	110.0	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
12		PREDRILL 30	1	1	128.000	30.000	188.0	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
13		DRILL Tool	1	1	110.000	25.000		<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
14		THREAD CUTTER	1	1	110.000	28.000	1	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
15		THREADCUTTER M10	1	1	138.000	18.000	1.500	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
16									
17									
18									
19									

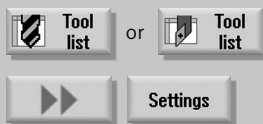

In the settings you can also select as to whether the tools should be graphically shown in the magazine.

Here you can activate whether the tool is read into or read out of a file (*.ini or *.to). When creating a tool, in the "New tool – favorites" dialog, the "Tool from file" entry is displayed.

2.7 Zero offset

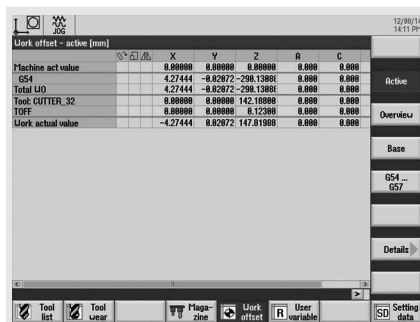

	X	Y	Z	R	C
Machine act value	0.88888	0.88888	0.88888	0.888	0.888
G54	4.27444	-8.82872	-298.13881	0.888	0.888
Total UO	4.27444	-8.82872	-298.13881	0.888	0.888
Tool CUTTER_32	0.88888	0.88888	142.18888	0.888	0.888
TGT	0.88888	0.88888	8.12288	0.888	0.888
Work actual value	-4.27444	8.82872	147.81888	0.888	0.888



Work
offset


Active

This view lists all zero offsets and frames active at runtime as well as the actual values of the Machine Coordinate System (MCS) and Workpiece Coordinate System (WCS).

Rotations, scaling and mirroring also shown as icons



Active zero offsets can be edited in the Reset status.

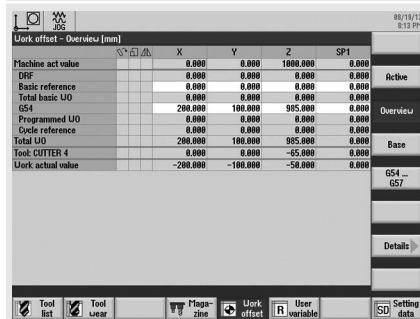


	X	Y	Z	SP1
Machine act value	0.888	0.888	188.888	0.888
DRF	0.888	0.888	0.888	0.888
Basic reference	0.888	0.888	0.888	0.888
Total basic UO	0.888	0.888	0.888	0.888
G54	298.888	188.888	985.888	0.888
Programmed UO	0.888	0.888	0.888	0.888
Cycle reference	0.888	0.888	0.888	0.888
Total UO	298.888	188.888	985.888	0.888
Tool CUTTER_4	0.888	0.888	-55.888	0.888
Work actual value	-298.888	-188.888	-58.888	0.888



Work
offset

Overview

This view shows an overview of all offsets.

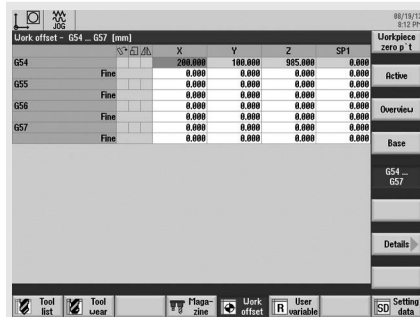

	X	Y	Z	SP1
G54	298.888	188.888	985.888	0.888
G55	0.888	0.888	0.888	0.888
G56	0.888	0.888	0.888	0.888
G57	0.888	0.888	0.888	0.888
G58	0.888	0.888	0.888	0.888



Work
offset

G54...
G57

All settable offsets, divided into coarse and fine offsets, are displayed in the "Zero Offset - G54..G599" window. Rotation, scaling and mirroring are displayed.

2.8 User variables

Variable	Value	Variable	Value
R0	0	R20	0
R1	0	R21	0
R2	0	R22	0
R3	0	R23	0
R4	0	R24	0
R5	0	R25	0
R6	0	R26	0
R7	0	R27	0
R8	0	R28	0
R9	0	R29	0
R10	0	R30	0
R11	0	R31	0
R12	0	R32	0
R13	0	R33	0
R14	0	R34	0
R15	0	R35	0
R16	0	R36	0
R17	0	R37	0
R18	0	R38	0
R19	0	R39	0



User variable

You can display the list of the user variables that you defined.

You can define the following variables:

- Global R parameters:
Can be defined across channels
- R parameters (arithmetic parameters):
Can be defined for each channel with a different value
- Global user variables GUID:
Are valid in all programs
- Local user variables LUD:
Are valid in the program in which they were defined
- Modal user variables PUD:
Are valid in the program in which they were defined, as well as all of the subroutines called by this program

Please refer to the documentation for more detailed information about defining variables and using parameters.


Variable	Value	Variable	Value
R 0	2345	R 20	50
R 1	4000	R 21	0
R 2	4000	R 22	0
R 3	80000	R 23	0
R 4	5	R 24	0
R 5	60	R 25	0
R 6	24000	R 26	0
R 7	24000	R 27	0
R 8	100000	R 28	0
R 9	0	R 29	0
R 10	0	R 30	0
R 11	0	R 31	0
R 12	0	R 32	0
R 13	0	R 33	0
R 14	0	R 34	0
R 15	5.052	R 35	0
R 16	0	R 36	0
R 17	0	R 37	0
R 18	0	R 38	0
R 19	0	R 39	0



Display comments

You can activate the display of comments for user variables using the "Display comments" softkey.

2.9 Program management

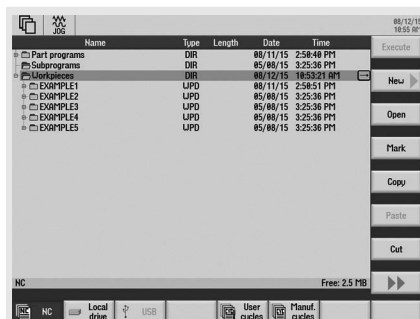

Using the Program Manager, you can manage folders and programs analogous to Windows Explorer.


You can find functions such as copying, selecting etc. on the vertical softkey bar.

Active programs have a green background.

The capacity of external data storage media and/or the NC memory is displayed at the bottom right.

You can directly access drives/network drives from the horizontal softkey bar. Depending on the configuration, you can directly access user and manufacturer cycles.



⇒ *The shortcuts for program management can be found in the appendix.*

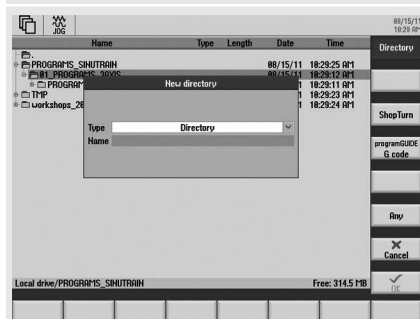


You can create folders and programs in a tree structure, on local drives and on the NC. The program names of the part programs have a maximum length of 24 characters.




- 1) Using the DXF Reader option, in the program manager you can open DXF files with the DXF Reader (see Chapter DXF Reader).

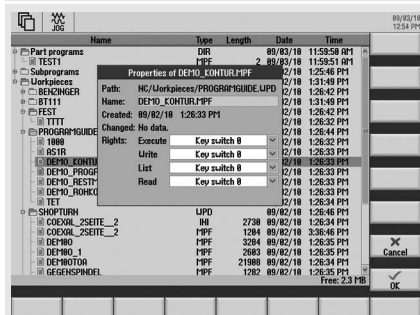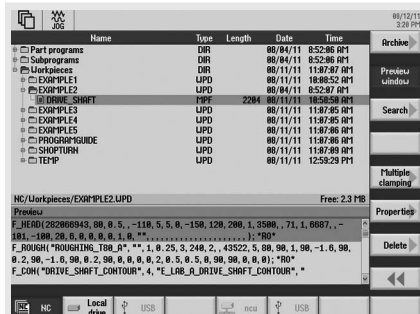


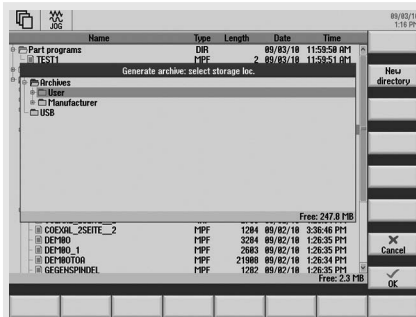

To backup and archive programs or program directories, you can create archives on drives/ network drives.

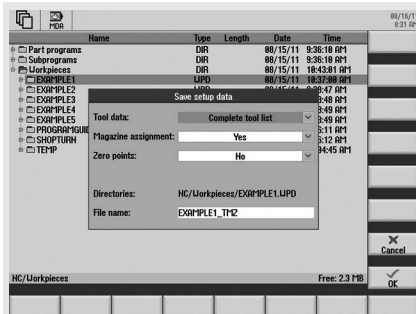


A data backup for the complete setup data, such as zero offsets, tool data, etc., can be performed for ShopMill/ShopTurn or programGUIDE programs. This allows a simple restore of workpiece setups.

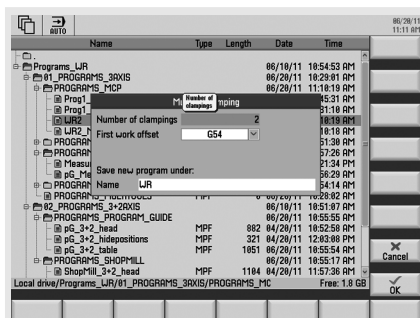

You can use the “Multiple clamping” function to group the machining programs for the respective clampings to form a complete program. The machining programs for the clampings can be identical or differ, as necessary.



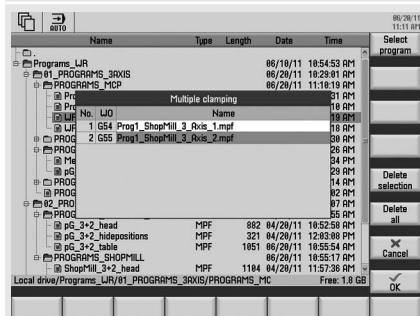

The machining steps are sorted in this program so that the number of tool changes (and thus the idle times) is reduced to a minimum.



In this view, you assign the associated zero offsets and programs to the clampings.




2.10 Programming

SINUMERIK Operate provides the appropriate programming method for every field of application.

ShopMill/ShopTurn	programGUIDE	programSYNC	ISO-Code
workstep programming	DIN/ISO & SINUMERIK high-level language	multi channel programming	with cycle support
			
<ul style="list-style-type: none"> • Designed for shortest programming time • Tailored for single parts and small batch sizes 	<ul style="list-style-type: none"> • Designed for maximal flexibility and shortest machining time • Tailored for medium to large batch sizes 	<ul style="list-style-type: none"> • Increased productivity for multi-channel machines • Suitable for single-piece small-batch and batch production 	<ul style="list-style-type: none"> • Designed for maximal ISO-code compatibility • Focused on medium to large batch sizes

The user and programming interface is uniform for all cycle screen forms irrespective of whether you use programGUIDE or ShopMill/ShopTurn. The only difference, the tool call and the technological information are directly integrated in the cycle for ShopMill/ShopTurn. More detailed information on the cycles is contained in the turning and milling sections.

Tips for working with the editors and the cycle screens, such as how to structure programs using blocks, follow.

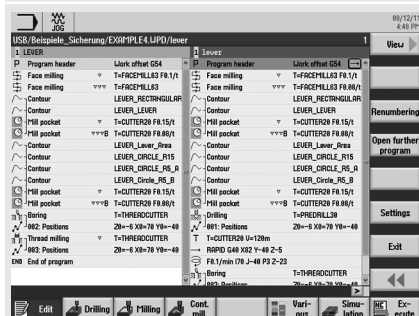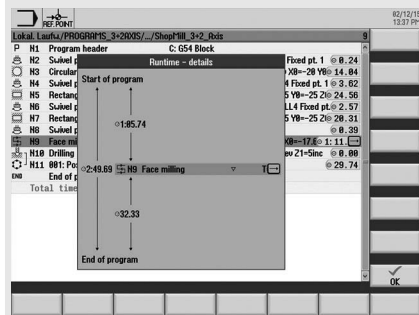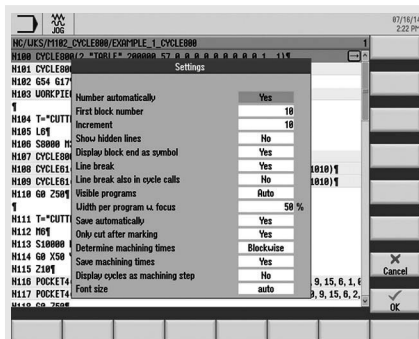

You can configure the editor under ShopMill/ShopTurn or programGUIDE. You can also set as to whether, e.g. line breaks should be displayed – also for cycle calls, cycles should be shown as work steps or machining times (simulation) should be determined. The machining times can be determined and saved block by block.

⇒ **CTRL+I shortcut**

Calculating the time from/up to line/block



If, for example, you want to compare programs or transfer program sections from one program to another program, you can open two programs concurrently.




⇒ **Cursor right**

Open another program

You can use the "Next window" key to the switch between the windows.



Click the "Close" softkey to close the second program.

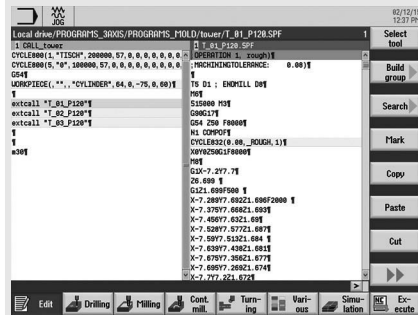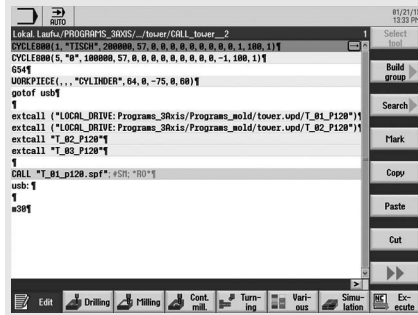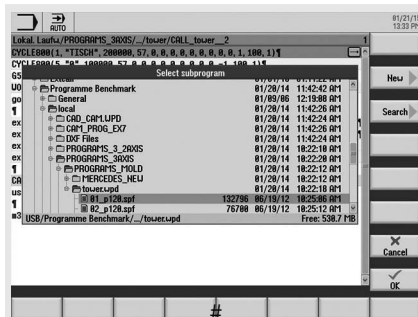


In the editor, you can find the “Subroutine” function under the “Various” softkey. Using this function you can insert a subroutine call in your program:

CALL = calls a subroutine from the NC memory

EXTCALL = Call of a subprogram from a local drive/USB/network

Subroutines are opened in an extended window, in parallel to the program.

Note: Subroutines are called using CALL or EXTCALL, depending on whether you are using the “Execution from external storage (EES)” option.

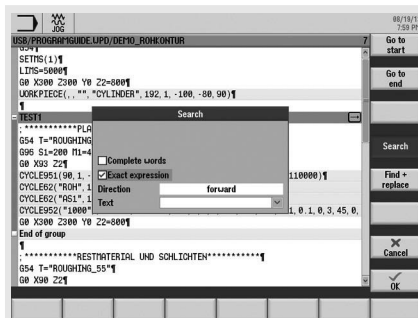


Click the "Find" softkey to start the search in the editors.

⇒ **Ctrl+F shortcut**




If you select a line before calling the search screen, the selected text will be transferred to the search field.

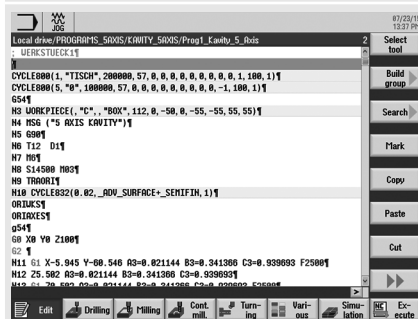


For better readability and transparency, the NC program syntax is color-coded:

- Comments (gray)
- NC blocks/functions (black)
- Tool calls/speed/feed rate (blue)
- G0 rapid traverse (red)
- G1 (green)
- G2, G3 (petrol blue)

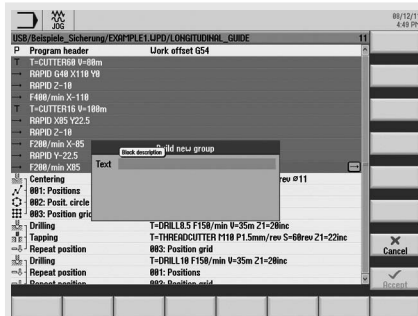


To structure large programs and individual machining steps, you can form program blocks in ShopMill/ShopTurn and in programGUIDE. The lines selected in the editor are grouped to form a program block. You can create additional program blocks within one program block (Block in block).

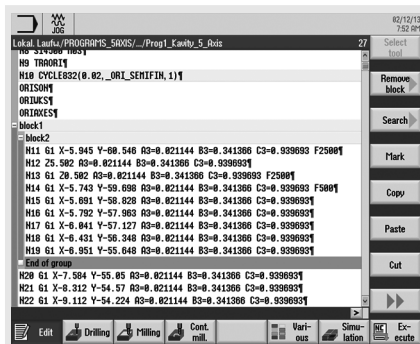

Remove
block

To ungroup a program block, navigate to the end of the block ("end of block" mark). The "Ungroup block" softkey is displayed instead of "Create block".

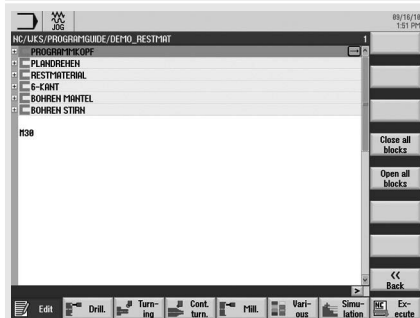

Edit

View

Open all
blocks

or

Close all
blocks

You can open and close the program blocks of the program.


Edit



or




You can use the arrow keys to open and close individual blocks.

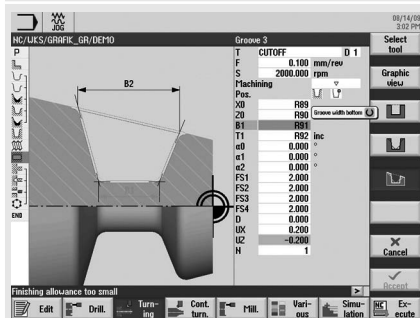



You can use parameters and variables to define the ShopMill/ShopTurn or programGUIDE cycles.

For more information about defining variables and the use of parameters, consult the documentation.

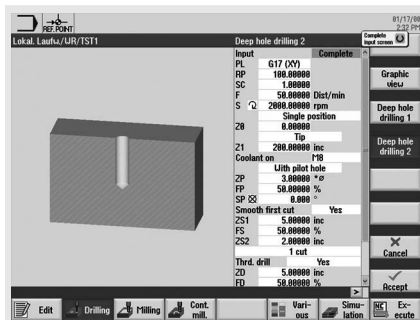

Certain parameters can be parameterized using setting data (SD) using the "Technology scaling in cycle screen forms" function; for example, the dwell time or the safety clearance for deep-hole drilling. These are then no longer displayed in the cycle screen forms.

The machine builder (OEM) must parameterize the function so that it is available.

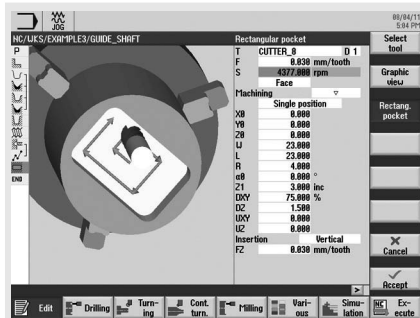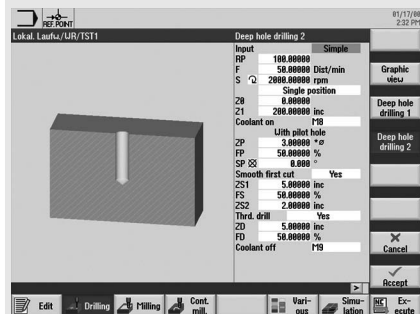


In ShopMill/ShopTurn, the feedrate/speed values are converted automatically by pressing the "SELECT" button.


2.11 DXF Reader

Using the integrated DXF Reader (option), you can transfer and/or extract contours and positions from DXF files. You can directly open DXF files from the Program Manager or in the contour and position pattern cycles using the „Import from DXF“ softkey. If necessary, in the DXF Reader you can rationalize the data that has been imported. You can also set the tolerance to identify gaps in the geometry. You can then transfer the selected contour or positions into the program.


DXF Reader in the Program Manager

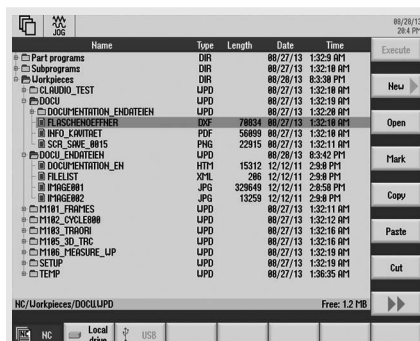

You can open DXF files in the DXF Reader using the Program Manager. Here, you can either automatically rationalize the DXF data, or you can select the required layer.


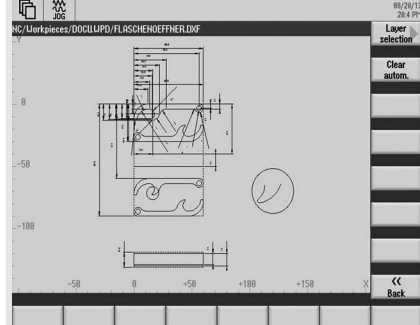


Importing DXF data into the contour computer

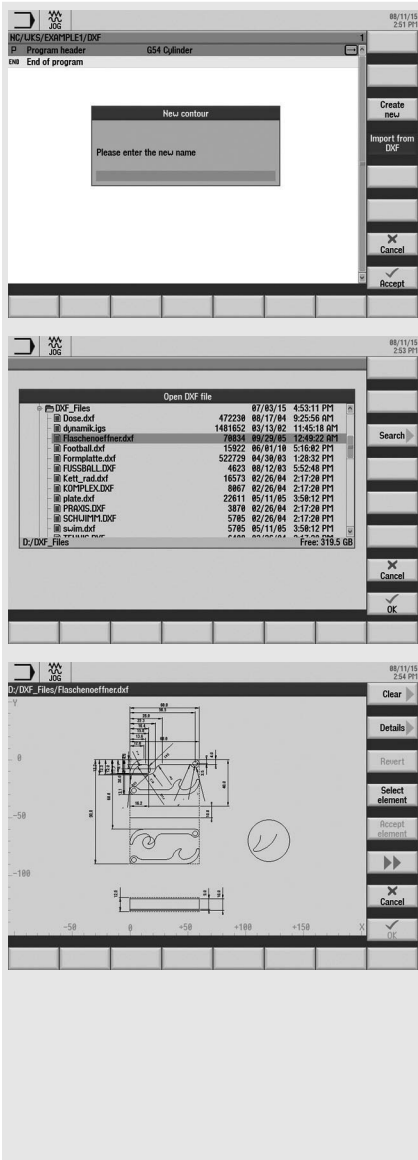

New contour **Import from DXF**

Enter the name of the new contour in the “New contour” dialog. Dialog “Open DXF file” is displayed after entering the name. Here, you can select the DXF file from which you wish to accept the contour. Confirm your selection with “OK”.

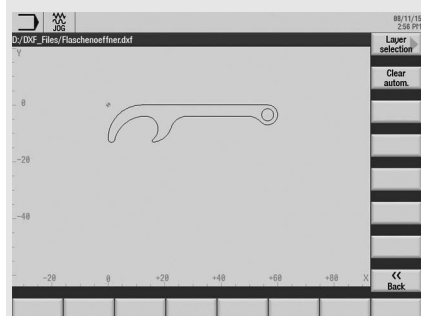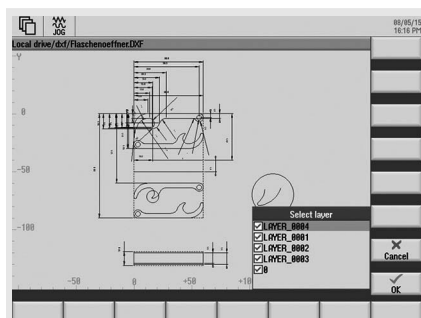


Clear

Clear autom.

or

Layer selection

Here, you can either automatically rationalize the DXF data, or you can select the required layer as shown in the example. Rationalized DXF files can be buffered as new DXF file.

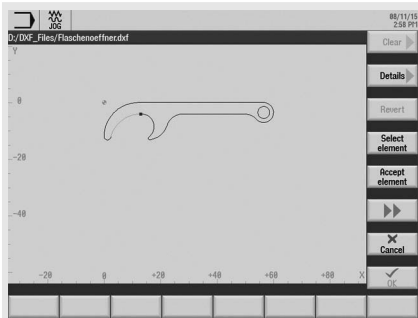


Select
element

Select a contour element.


Accept
element

Accept the selected contour element.

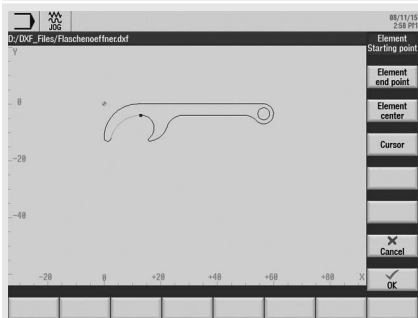


Element
Starting point

For the selected element, define the start of the contour, and confirm your selection with "OK". In the example, the start of the contour is located at the starting point of the contour element.

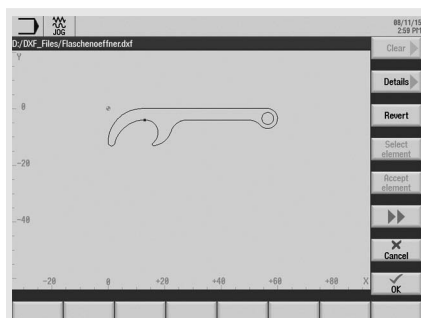


Accept
element

Accept the remaining contour elements. The contour is transferred into the contour computer using the "OK" softkey.

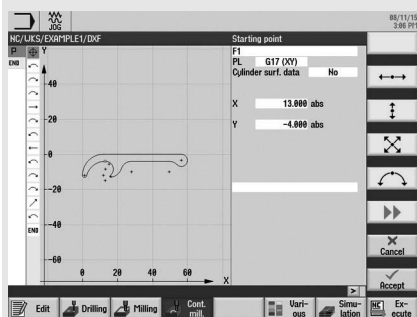

Importing DXF data into the position patterns

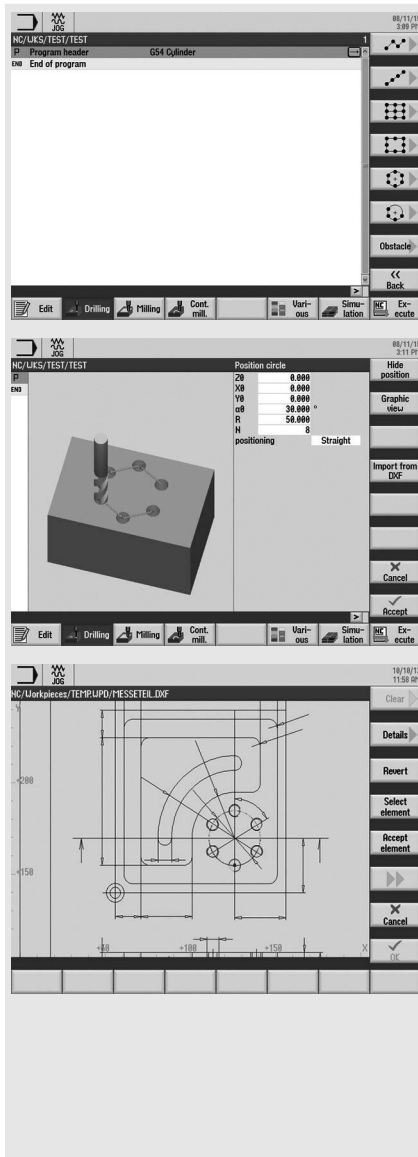

Import from
DXF

Under the particular technologies, for the position pattern, you can import the positions from a DXF file. The procedure in the DXF Reader is analogous to accepting contours.

2.12 Execution from external storage (EES)

Using the „EES“ function, you can execute and call part programs directly from internal or external storage media.

You have the following advantages when executing programs in the EES mode:


- The restrictions that are applicable for programs for „Execute from external“ and „Execute from external subroutine (EXTCALL)“ – no reverse jumps, no wide jumps, no long program loops (goto/gotof/gotob) – have been resolved with EES.
- The size of the part program is only restricted by the size of the external data archive.
- Standard syntax for subroutine call, independent of the archive location of the subroutine (EXTCALL call is not required).
- Program correction is possible for NC stop.

■ **Note:** If necessary, contact your machine builder (OEM) regarding this function.

2.13 Workpiece visualization

To increase the programming reliability and as control capability, SINUMERIK Operate provides a user-friendly simulation (2D and 3D) as well as the fast display for mold making applications.

Simulation

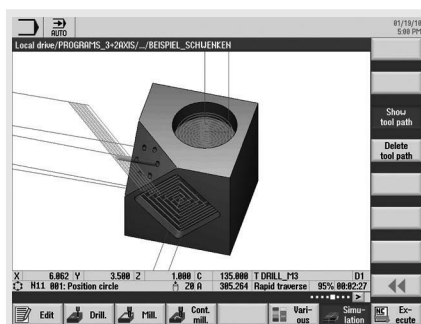



- The machining time is calculated automatically (display at the lower right).



The simulation offers the following different views:

- 3D simulation with 3-level view and volume model of the finished part.



⇒ The shortcuts for operating the simulation are contained in the appendix.

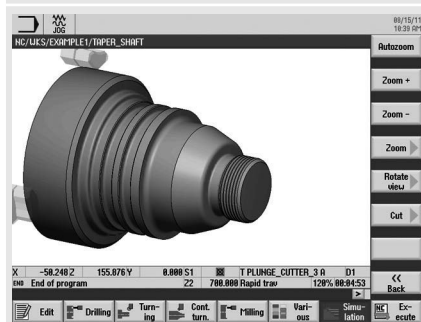

Details

- Details zoom, magnifying glass for enlarging a workpiece detail, rotate view.


⇒ The shortcuts for operating the simulation are contained in the appendix.

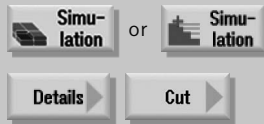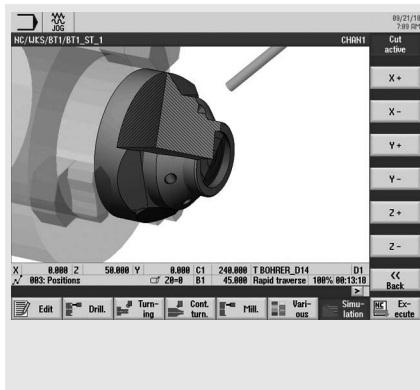

- 3D cross-section view details.

⇒ The shortcuts for operating the simulation are contained in the appendix.

Moldmaking quick view

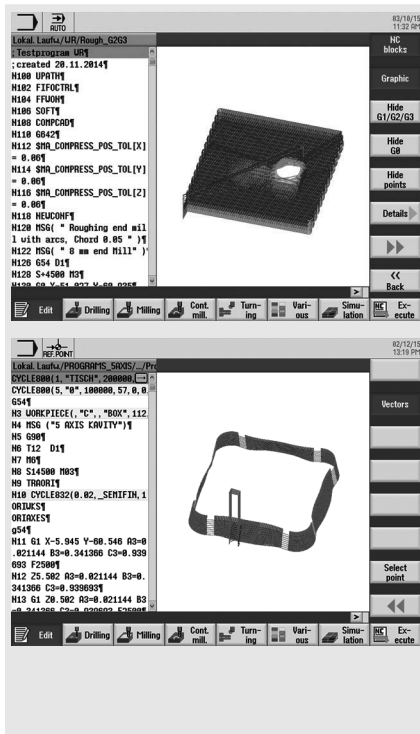

The mold making view is available in the edit mode for especially large part programs.



G0, G1, G2, G3, BSPLINE and POLY lines, VEKTOREN as well as points that can be displayed and hidden are shown.

Cycle processing is not shown.

Rotary axis as well as vector programming for 5-axis programming is supported.

The syntax is not checked.


2.14 CNC operation in Automatic mode (AUTO)

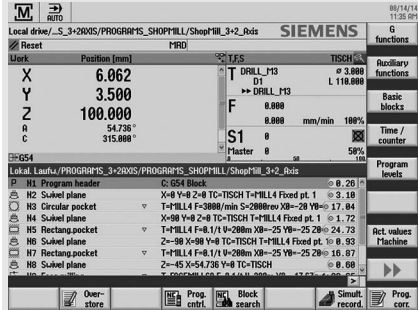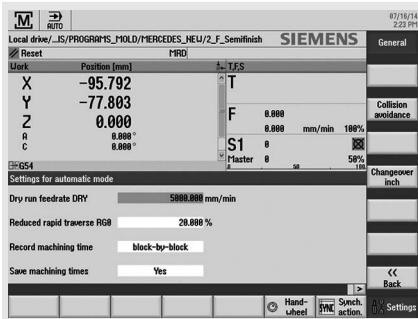

For the automatic mode, in addition to the test feedrate and the reduced rapid traverse, you can define whether the machining time is to be recorded and displayed.

In so doing you can select between “non-modal” and “block-by-block”.

In addition, you can define as to whether the machining times should be saved.

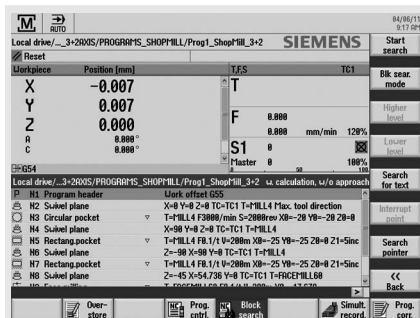


Requirement: The program is selected and the controller is in Reset status.



You can perform a block search in the Reset machine status. The program data is prepared so that all relevant parameters (tool, zero offsets, M functions, etc.) are available when the program is entered.


The following search variants are available:

- Targeted at the interruption point, even after power off, is also possible
- To any CNC block in the DIN/ISO programs
- To any subroutine levels in DIN/ISO programs
- In ShopMill/ShopTurn machining step programs
- In the position patterns for the ShopMill/ShopTurn machining step programming
- Accelerated block search in large mold making programs

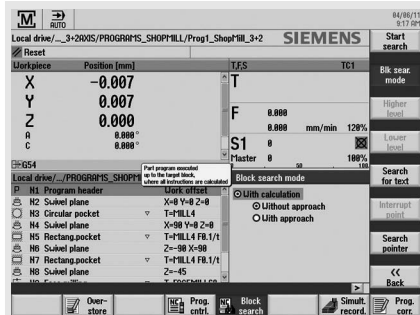

The block search can be customized:

- With calculation/without calculation
- With approach/without approach

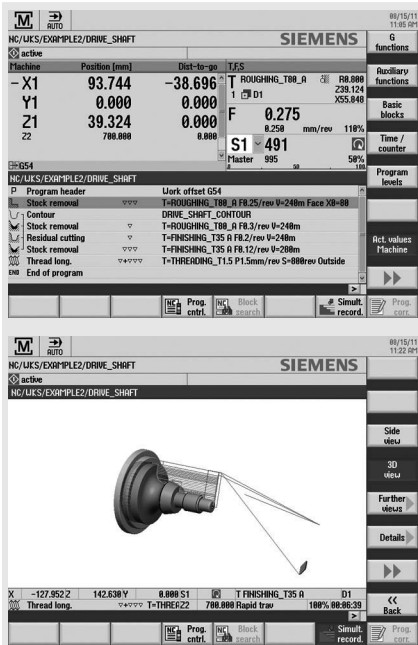

Ex-
ecute

Simult.
record.

 or


Simult.
record.

CYCLE
START

If required, you can activate the simultaneous recording while machining the workpiece.

You can select various display formats for the simultaneous recording.

⇒ *The shortcuts for the simultaneous recording are described in the appendix.*

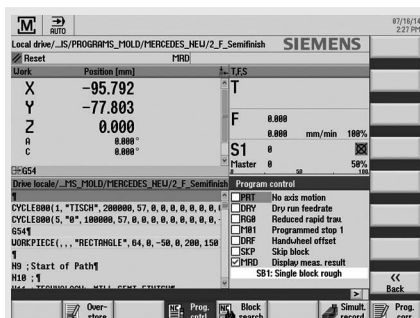


You can influence the execution of a program in AUTO and MDA mode:

- **PRT – no axis movement**
You can also activate the program processing without axis movements, also together with the "Dry run feedrate" function.
- **DRY – dry run feedrate**
The traversing velocity programmed in conjunction with G1, G2, G3, CIP and CT is replaced with a defined dry run feedrate. Caution for activated dry run feedrate - the modified feedrate values may cause a violation of the cutting rate.
- **RG0 – reduced rapid traverse**
You define the reduced rapid traverse in the settings for Automatic mode.
- **M01 – programmed Stop 1**
The program processing stops for those blocks in which the M01 supplementary function is programmed. In this way you can check the previously-obtained result during the machining of a workpiece.
- **DRF – handwheel offset**
This selection enables an additional incremental zero offset with the electronic handwheel while being machined in Automatic mode.
- **SKP**
Skip blocks are skipped during machining.
- **MRD**
The display of the measurement result can be activated or deactivated while the program is being executed.

2.15 Logging measurement results in the automatic mode

When measuring workpieces and tools in the automatic mode (CYCLE 150, CYCLE 151) you can output measurement results to a measurement log.

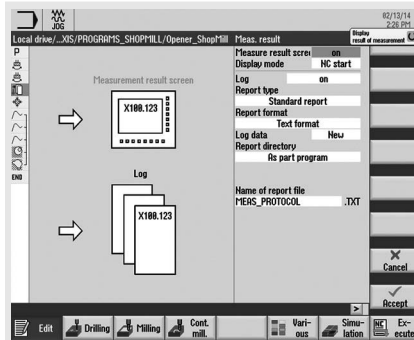

Meas. result

You can configure the output in the “Measurement result” screen form. The following settings are also possible:

Display mode:

- autom. 8s
- NC start
- for alarm

Log:

- off
- on
- last measurement

Log type:

- Standard log
- User log

Log format:

- Text format (*.txt)
- Table format (*.csv)

Log data:

- New (reject old log data)
- Attach (attach to old log data)

Log archive:

- Archive directory (complete path)

Log file name:

- Log file name (file extension corresponding to what was selected under the log format)



```

*****
Date       : 2014- 2- 3                      Time: 10:59:58
Protocol:  / _N_MPF_DIR/MEAS_PROTOCOL_TXT_MPF
Program   :  / _N_MPF_DIR/_N_OPENER_SHOPMILL_MPF
Workpiece No:
*****
--
1          : 977/106                      Time: 10:59:58
Results measure: Rectangel spigot / CYCLE977
-----
Correction into: Work offset, Coarse
G54
Coarse [mm]   Fine [mm]   Rot [deg]
-----
X              -8.294 <    0.000    0.000
Y              3.052 <    0.000    0.000
Z              0.000 <    0.000    0.000
-----
Results:      Setpoint value  Measured value  Difference val
-----
X              30.000      29.988      -0.012 mm
Y             -15.000     -15.012     -0.012 mm
LENGTH X      90.000      90.791      0.791 mm
Width Y       60.000      60.791      0.791 mm
-----

```

	A	B	C	D	E
1					
2					
3	*****				
4	Date : 2014-2-3				
5	Time: 11:1:5				
6	Protocol: /_N_MPF_DIR/MEAS_PROTOCOL_CSV_MPF				
7	Program: /_N_MPF_DIR/_N_OPENER_SHOPMILL_MPF				
8	Workpiece No:				
9	*****				
10	1 : 977/106				
11	Time: 11:1:5				
12	Results measure: Rectangel spigot / CYCLE977				
13	Correction into: Work offset, Coarse				
14	G54				
15		Coarse [mm]	Fine [mm]	Rot [deg]	
16	X	-8.294	0.000	0.000	
17	Y	3.052	0.000	0.000	
18	Z	0.000	0.000	0.000	
19	Results: Setpoint value Measured value Difference val				
20	X	30,000	29,988	-0,012	mm
21	Y	-15,000	-15,012	-0,012	mm
22	LENGTH X	90,000	90,791	0,791	mm
23	Width Y	60,000	60,791	0,791	mm
24					
25					


Open the measurement log in program management under the configured archive path.

The measurement log always also includes the following data:

- Date and time when the log was written to
- Log name with path
- Measurement version
- Correction target
- Setpoints, measured values and differences


Note: The measurement protocols are output in English, independently of the interface language.

2.16 Collision Avoidance

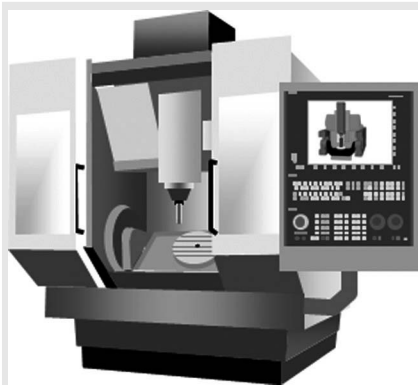


The SINUMERIK Collision Avoidance option provides optimum protection against unwanted collisions of moving machine components with static machine components. The collision monitoring is also possible for complex machining, such as 5-axis simultaneous milling and turning with the B-axis.

■ **Note:** Prerequisite for use of the collision monitoring is the availability of the relevant machine data and the appropriate visualization.

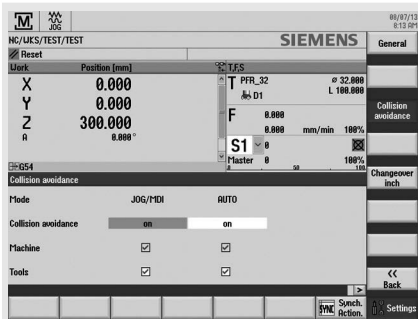

The collision monitoring can be activated in the Machine operating area for the JOG, MDA and Automatic operating modes.

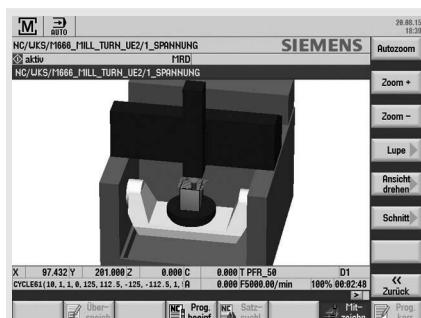

3 Turning technology


In addition to the guidelines for setup and programming, this chapter provides an overview of the technology cycles for drilling, turning, contour turning, milling and contour milling. You can also obtain information on the machining of workpieces on a counter-spindle and an overview of the cycles for the in-process measurement.



3.1 Setting up

The following sections contain information for setting the zero offset and measuring workpieces and tools in JOG.

3.1.1 Setting the zero point

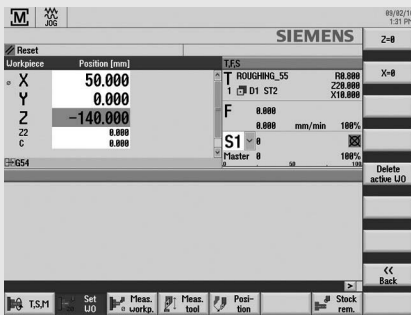

Requirement: A zero offset must be active.


Note: The “Set WO” function is also possible in the STOP state.



In the “Set ZO” dialog box, you can write direct position values for individual axes in the actual value display.

The difference between the position value in the machine coordinate system (MCS) and the workpiece coordinate system (WCS) is saved in the active zero offset.

3.1.2 Workpiece zero

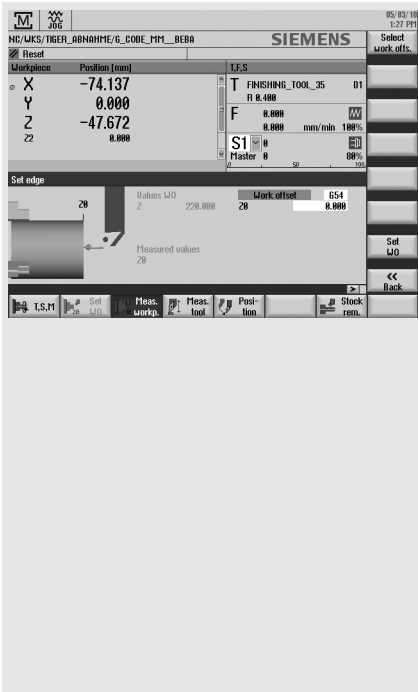


You are guided graphically for setting the workpiece zero.

To determine the zero point, determine the length of the workpiece and save the position of the cylinder face surface in the direction Z in a zero offset.

When the workpiece zero/zero offset is calculated, the tool length is automatically taken into account.


If you wish to measure the workpiece zero in "Measuring Only" mode, the measured values are merely displayed without any changes being made to the coordinate system.

3.1.3 Tool measurement

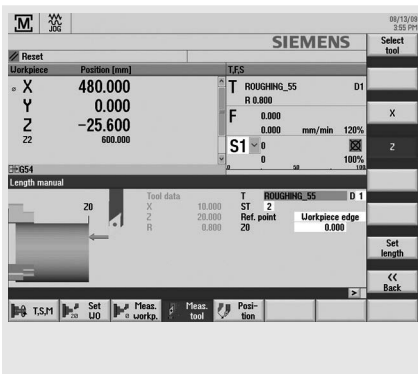

Manual

You are guided graphically for calibrating the tools (all tool types).

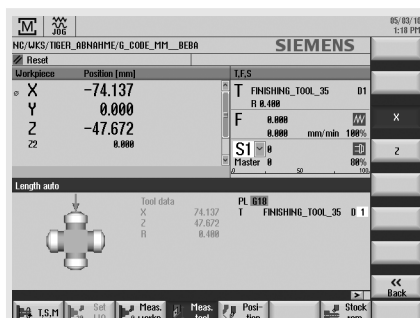


Note: Information about logging measurement results is provided in Chapter “Logging measurement results in JOG”




If you wish to measure your tools with a tool probe, the machine manufacturer must parameterize special measuring functions for that purpose.

Enter the cutting edge position and the radius or diameter of the tool in the tool list before performing the actual measurement.

If turning tools with tool carrier that can be oriented are measured around Y using any positions of the swivel axis, then it should be taken into consideration that the turning tool is measured with the same tool position in both axes X/Z, assuming that this is possible.

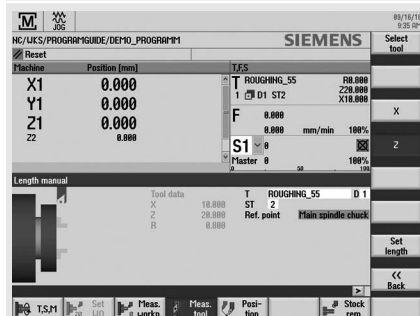

During the tool measurement, you can also scratch at the primary or counterclamping holder (fixed point in the machine).

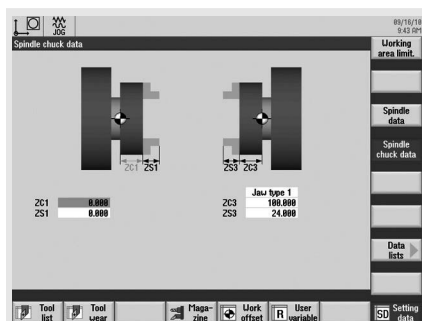

Setting
data




Spindle
chuck data

Define the main and counterclamp holder in the spindle chuck data.

Parameter ZC1 is used as reference point for the tool measurement.

You must enter this parameter if you are machining with the counterspindle! This function is available only in the ShopTurn machining step programming.

3.2 Manual Machine

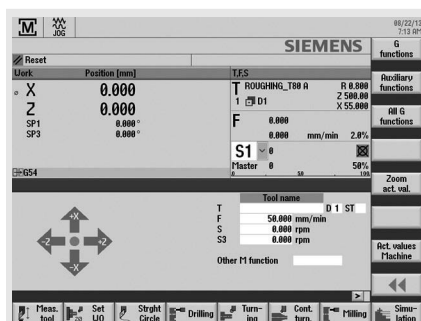

Note: Overviews of the drilling, turning, milling and contour-turning cycles are contained in Section 3.3, Programming.

The Manual Machine operating area provides you with machining capabilities as for a cycle turning machine. All important machining actions can be performed without an associated part program needing to be created.

The following functions are available:


- Measure tool
- Traverse axes
- Set zero offset (ZO)
- Turn straight line / circle
- Drill, such as centered drilling, centering, deep-hole drilling
- Turn, such as stock removal, grooving, thread cutting
- Mill, such as face milling, pocket milling, multi-edge stud milling
- Turn contour

User-friendly input screens with help screens and animated elements are available for parameterizing the cycles.


For the manual workpiece machining, the axes and spindles are controlled using the following options:

- Control of the cross slides using
 - Handwheels of the X- and Z-axis, or
 - Axis direction switches.
- Spindle control using
 - Spindle rotation direction switches.


The following example with a stock-removal cycle illustrates the operation as a Manual Machine.

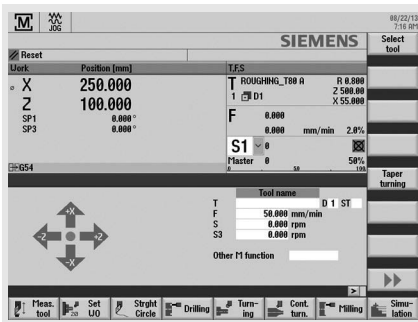

First position the axes, in the example, X=250, Z=100.

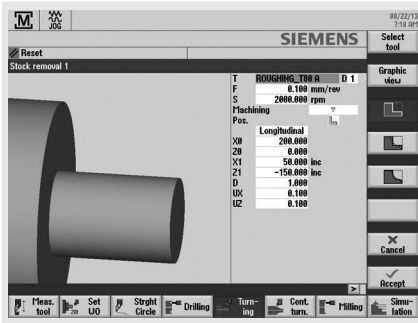

Parameterize the stock-removal cycle.

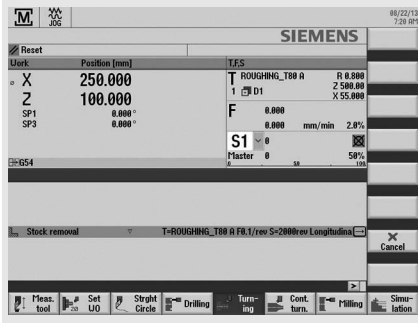

After the acceptance, start the machining with CYCLE START.

3.3 Programming


This section provides you with an overview of the design of the programs under ShopTurn machining step programming and programGUIDE.

3.3.1 ShopTurn


Each program line in the ShopTurn machining step editor represents a technological machining step (example: face turning, centering, ...) or the geometric data required for the machining steps (position patterns or contours). You do not need any knowledge of DIN/ISO for entering the individual machining steps. All required technical and geometric parameters are entered in cycle screen forms. If necessary you can also enter DIN/ISO blocks and control functions in the machining step editor.



The example shows the linking of the contours with the associated stock removal cycles.

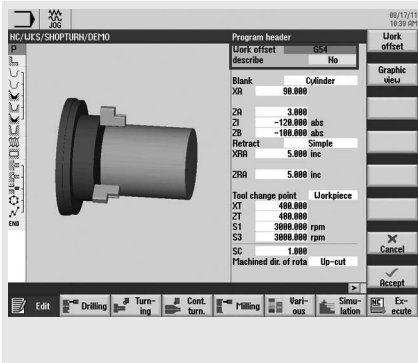

You can decide in the program header whether a value from the program is to be written to the zero offset. This avoids the need for the separate back up of the zero points.

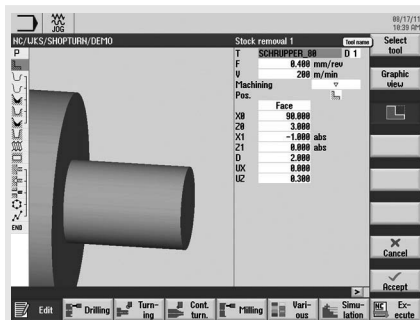

The technology data is directly integrated in the cycle.


The workpiece is shown dynamically during programming.


You can also enter parameters in the input fields of the cycles.

3.3.2 programGUIDE

In programGUIDE, in addition to the DIN/ISO editor, the technology cycles are also available similar to the ShopTurn machining step programming. This ensures an optimum integration. You also enter the calls for tool, feedrate, spindle speed, etc. in the DIN/ISO editor.

The following figure shows the structure of a program.

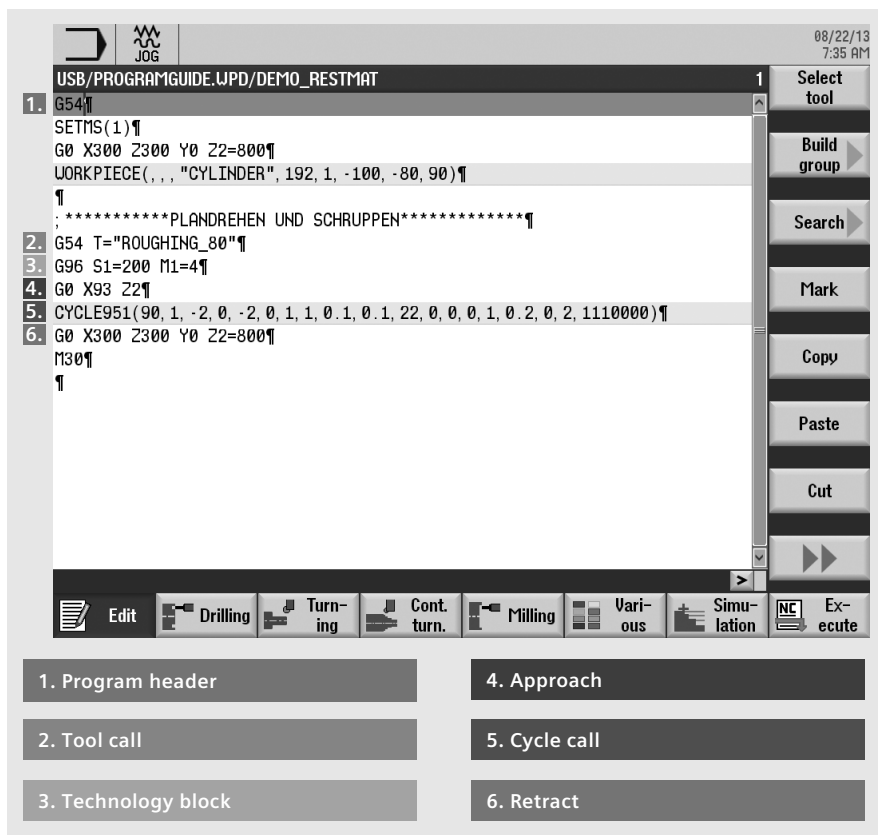

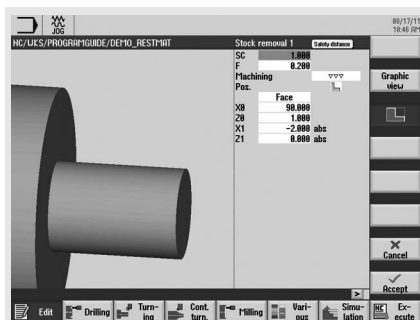



As example, you see from the above example the technology cycle for stock removal (see cycle call).

3.4 Drilling


This section provides an overview of the drilling cycles in the ShopTurn machining step programming and programGUIDE. As an example, the cycles for centered and off-centered drilling for ShopTurn machining step programming and programGUIDE are explained.

3.4.1 Overview of drilling cycles

An overview of the drilling cycles in ShopTurn machining step programming and programGUIDE with application tips is shown below.

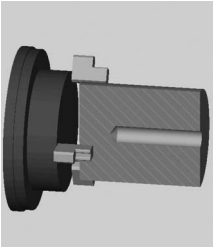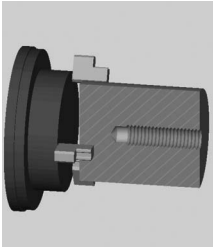Drilling center Only ShopTurn			
			
<div>Drilling center</div> <p>Cycle to generate centric drill holes with a static tool</p>	<div>Thread center</div> <p>Cycle for creating centric threads with a static tool</p>		


Centering

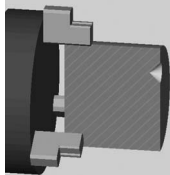

Cycle for centering at any positions

■ For ShopTurn, only with a driven tool


Drilling Reaming

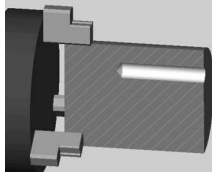

Drilling

Cycle for drilling holes in an infeed at any positions


■ For ShopTurn, only with a driven tool

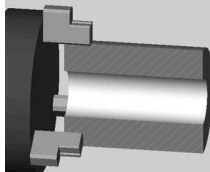

Reaming

Cycle for drilling corrective work with a reamer at any positions

■ For ShopTurn, only with a driven tool

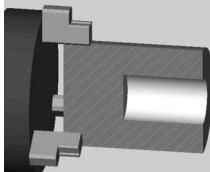

ShopTurn:


Boring

programGUIDE:

Boring

Cycle for boring drilled hole diameters with special boring tools at any positions


Deep hole drilling

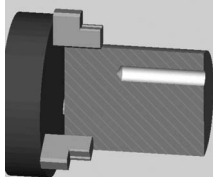

Deep hole drilling 1

Cycle to create holes with more than one infeed at any position

- For ShopTurn, only with a driven tool

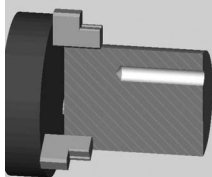


Deep hole drilling 2

Cycle to create holes with more than one infeed at any position, with extended drilling strategies, for example, a pilot hole or soft first cut, for example.

The use of deep hole drills (gun drills) is supported.

- For ShopTurn, only with a driven tool


Thread

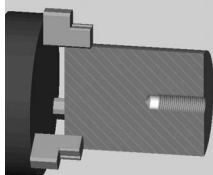

Tapping

Cycle for tapping at any positions

- For ShopTurn, only with a driven tool

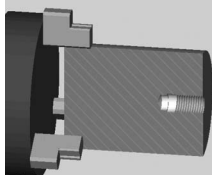


Drill+thrd milling


Cycle for thread cutting with special drill and thread milling cutters at any positions

- For ShopTurn, only with a driven tool


Positions

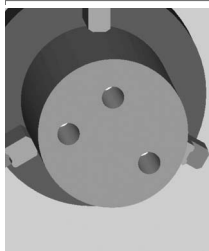


Cycle for the input of free positional data

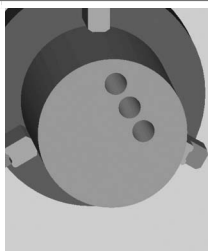


Cycle for the input of a position series

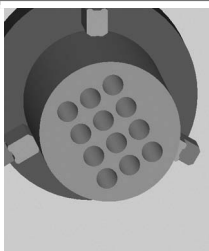


Cycle to enter any number of positions with the same spacing on a matrix/grid

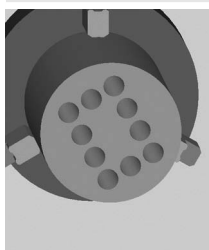

Cycle to enter any number of positions with the same spacing on a frame

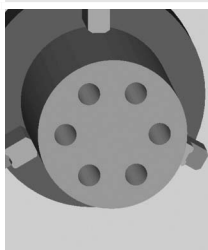


Cycle for entering a circle of holes

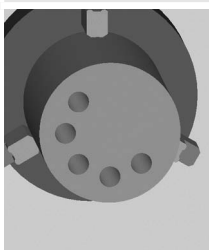

Cycle to enter positions along an arc with a defined radius.

3.4.2 Drilling centered/off-centered with ShopTurn

The following example explains how you drill a centered/off-centered hole with ShopTurn machining step programming.

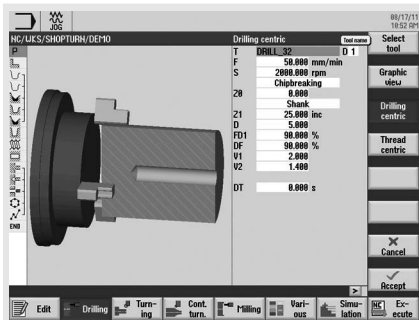


■ This cycle is available only under ShopTurn.

Drilling
centric

Drilling
centric

You can use this cycle to drill a hole in the center of the end face. You can choose between chip breaking during drilling or retraction from the workpiece for stock removal.

During machining, either the main spindle or the counterspindle rotates. You can use a drill, a rotary drill or even a milling cutter as the tool.

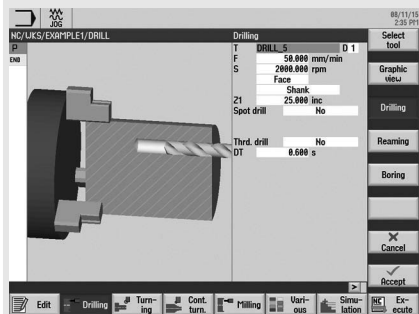


Drilling
Reaming

Drilling

Use the "Drill" cycle if you wish to machine a hole at any position on the face or peripheral surface.

Here, enter feed F, final depth X1 and dwell time DT.

In addition, you can parameterize "Spot drilling" and "Through drilling". Then, using the Position cycle, you can define the drilling position (see below).

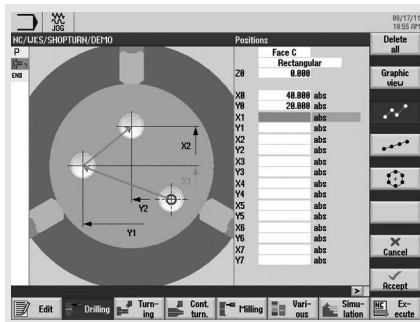


Positions

e.g.



You can define a maximum of eight drill positions. To program other freely programmable positions, you must call the "Freely programmable positions" function again.

3.4.3 Drilling with programGUIDE

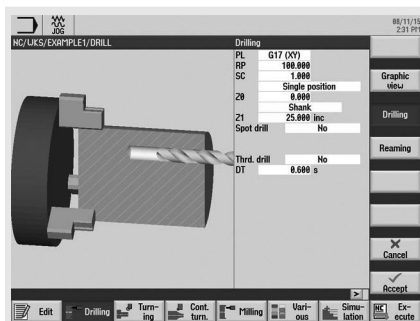


Drilling
Reaming

Drilling

Use the "Drill" cycle if you wish to machine a hole at any position (centered or off centered) on the face or peripheral surface.


You can select whether you wish to machine a hole on the face or peripheral surface at machining level PL. Enter the drilling depth in the field Z1.

In addition, you can parameterize "Spot drilling" and "Through drilling". Then, using the Position cycle, you can define the drilling position (see below).

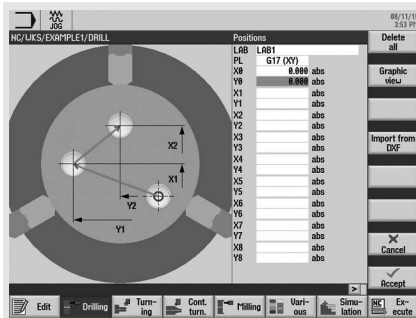

■ **Note:** You define the technology data, such as tool, direction of spindle rotation, feedrate, etc., before calling the cycle.

For the machining on the end face, activate the TRANSMIT function; for machining operations on the peripheral surface, activate the TRACYL function. The position pattern must be deselected again with MCALL.




You can define a maximum of eight drill positions. To program other freely programmable positions, you must call the “Freely programmable positions” function again.


3.5 Turning

This section provides an overview of the turning cycles in the ShopTurn machining step programming and programGUIDE.


3.5.1 Overview of the turning cycles

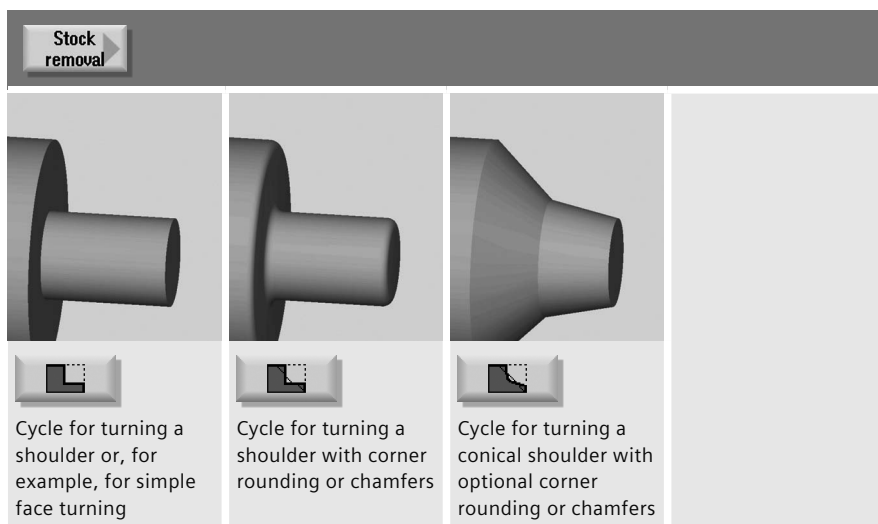


Groove

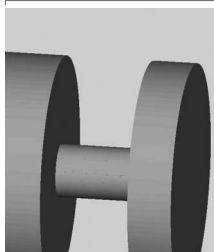

Grooving cycle with-
out rounding

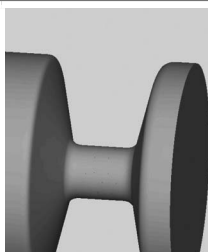


Extended grooving
cycle with optional
rounding or chamfers
and additional
conicity

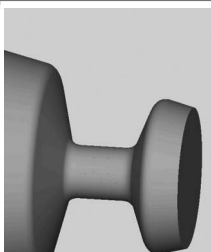


Extended grooving
cycle on conical
turned parts


Undercut

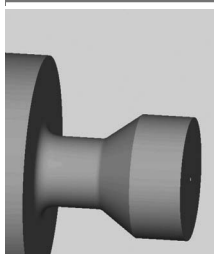


Cycle for external or
internal undercuts
according to the
standard E

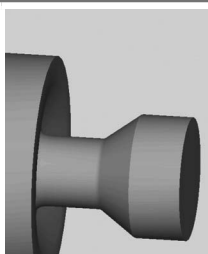

Cycle for external or
internal undercuts
according to the
standard F

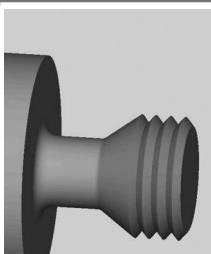


Cycle for external or
internal thread
undercuts according
to the DIN standard

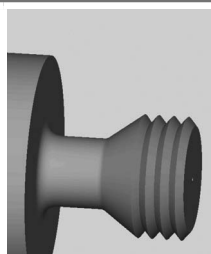


Cycle for external or
internal thread
undercuts without
any standard (freely
programmable)

Thread

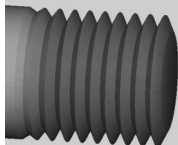


Thread long.

Thread cycle for longitudinal thread

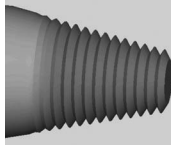


Thread taper

Thread cycle for tapered threads

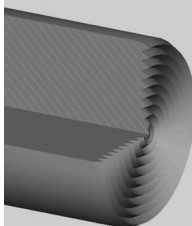

Thread face


Thread cycle for face thread

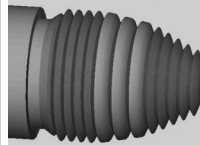

Thread chain

Thread cycle for chaining different threads in a single operation

Cutoff


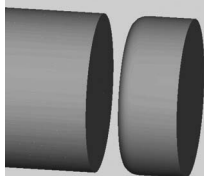


Cycle for parting rod parts

3.6 Contour turning

This section provides an overview of the contour machining cycles in the ShopTurn machining step programming and programGUIDE. The contour turning with ShopTurn machining step programming and programGUIDE is explained as an example.


3.6.1 Overview of the turning cycles for the contour machining

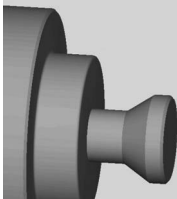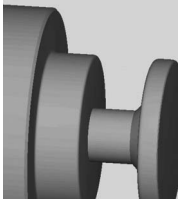Stock removal or Cut resid stock	
	<p>Stock removal cycle for machining any contours with the stock removal technology; it can be combined with automatic residual material detection</p> <p>■ Note: Manual Machine does not support residual material detection.</p>
Grooving or Groove resid.	
	<p>Grooving cycle for machining any contours with the plunge-cutting technology; it can be combined with automatic residual material detection</p> <p>■ Note: Manual Machine does not support residual material detection.</p>

Plunge turning

or

Plunge turn.resid.

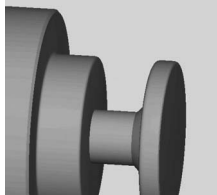


Plunge-turning cycle for machining any contours with the plunge-turning technology; it can be combined with automatic residual material detection

Note: Manual Machine does not support residual material detection.

Note: The technologies can be combined on a contour!

3.6.2 Contour turning with ShopTurn machining step programming

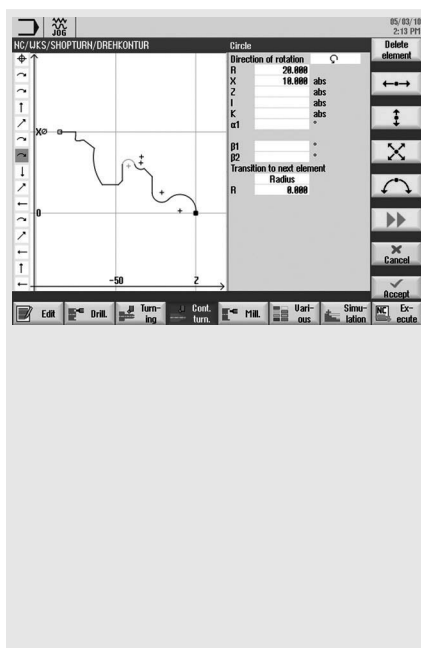


Cont. turn.

New contour

Create a new contour in the contour calculator.


You can enter as many as 256 geometric elements.

Note: Contours can be renamed.

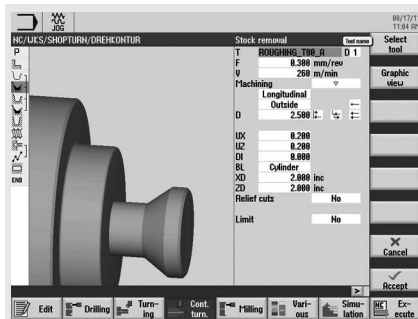


The settings that can be selected for stock removal and stock removal residual material include:

- Align cut segmentation to edges
- Alternating cutting depth

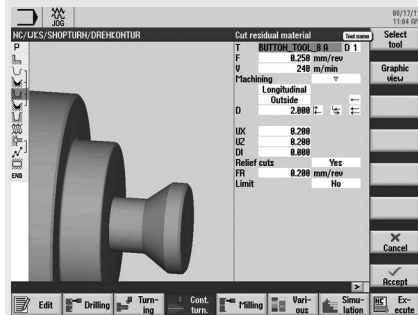

The "Stock removal residual material" cycle automatically performs a residual material detection.

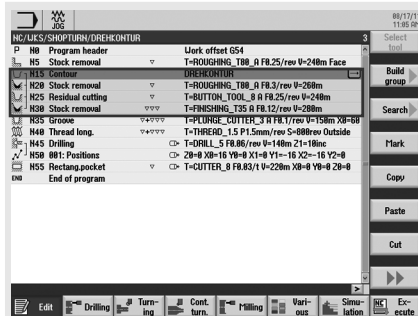

The contour and the stock removal cycles are linked in the machining step editor.

- Before the residual stock removal cycle, you must always set a preceding roughing cycle on which the residual stock removal is based.

You can also program several successive residual material cycles, when, for example, different tools must be used.


The contour call and calls of the stock removal and residual stock removal cycles are explained using the following example program.



You have the following ways of including a contour call in a programGUIDE program:


The contour is contained in the main program directly behind M30	<div>Contour call</div> <div>CON</div> <div>Contour name</div>
The contour is contained in a subroutine	<div>Contour call</div> <div>PRG</div> <div>Subprogram</div>
The contour is contained in the main program between two labels	<div>Contour call</div> <div>LAB1</div> <div>LAB2</div> <div>Labels</div>
Call using labels in a subroutine	<div>Contour call</div> <div>PRG</div> <div>LAB1</div> <div>Labels in subprogram</div>

We start by adding the contour call, in our example, the call is made using the contour name. The contour is then written and added at the program end (M30). In our example, the contour is given the name "AS1".

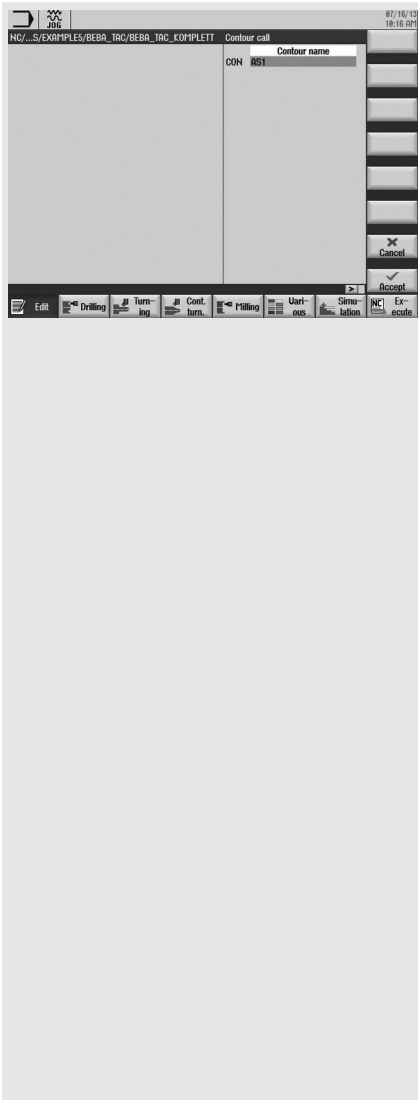

First insert the contour call at the desired location in the program. Note the above figure for contour calls.

In the next step, we add the cycles for the stock removal.

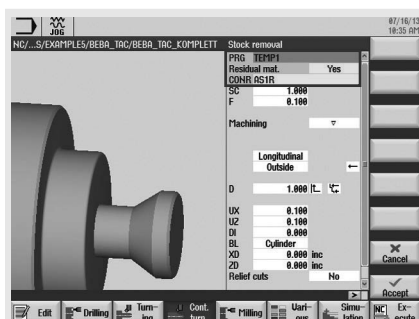



■ **Note:** The contour name for the residual stock removal must be unique because it will be used again in the next stock-removal cycle.



Enter a name in the “PRG” input field. This name is arbitrary, but must be unique. This means, for example, that the name must not be the same as the name of the contour to be machined. In the example, enter the name “TEMP1”.

Because the contour used in our example also has relief-cut elements that cannot be machined with the stock-removal tool, residual material results. This residual material is cut in the next machining operation. Consequently, the “Residual material” parameter must be set to “yes”. You must also specify a name for the residual-material contour, in our example, “AS1R”.


In the further program execution, the tool is now changed and the “residual material stock removal” cycle added.

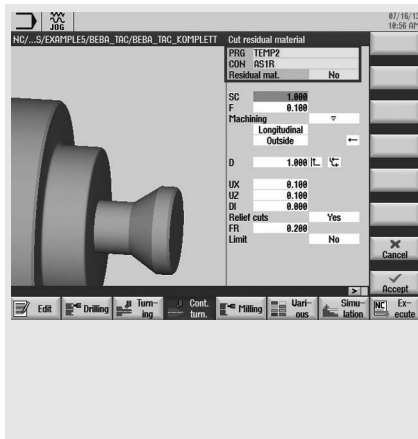

In the “residual material stock removal” cycle, enter a name in the “PRG” input field, in the example, “TEMP2”. You must now enter the name of the stock-removal contour from the previous stock-removal cycle in the “CON” input field. In our example, “AS1R”.


If residual material also results in this machining step, the “Residual material” parameter can also be set to “yes” here and a further residual-material contour created. In the example, we select, however, “no”.

Finally, the contour is finished. To do this, select the “stock removal” cycle again.

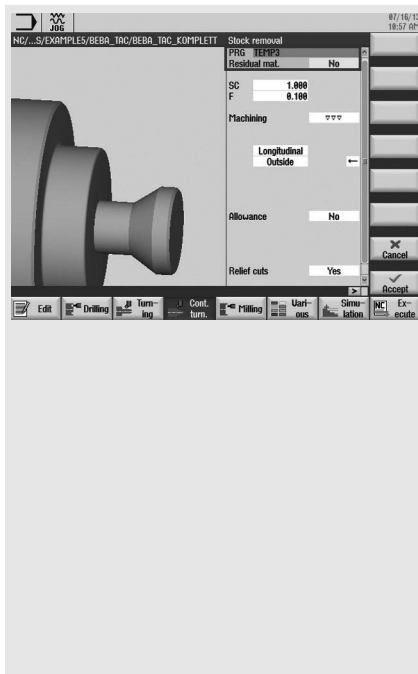

Enter the name “TEMP3” in the “PRG” input field. Select the value “no” for the “Residual material” parameter and “finish” in the “Machining” field.

You must still define and add the target contour after the program end (M30).

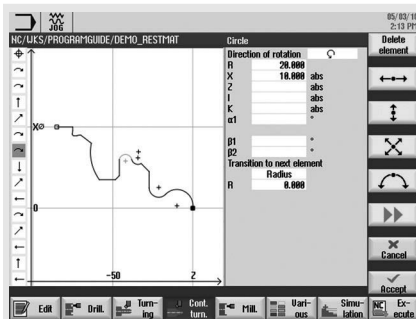

- You can enter as many as 256 geometric elements.

■ **Note:** Contours can be renamed.





Create a new contour in the contour calculator.

3.7 Milling

This section provides an overview of the milling cycles in the ShopTurn machining step programming and programGUIDE.

3.7.1 Overview of the milling cycles

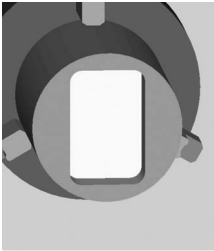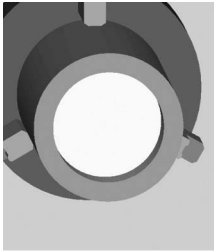
Pocket			
			
Rectang. pocket	Circular pocket		
Cycle to produce a rectangular pocket on the end face or the peripheral surface	Cycle to produce a circular pocket on the end face or the peripheral surface		

Multi-edge spigot



Rectang. spigot

Cycle to produce a rectangular spigot with a rectangular blank on the end face or the peripheral surface

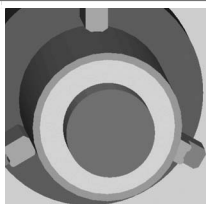

Circular spigot

Cycle to produce a circular spigot with a round blank on the end face or the peripheral surface



Multi- edge

Cycle to produce a polyhedron on the end face

Slot




Longit. slot

Cycle to produce longitudinal grooves on the end face or the peripheral surface




Circumfer. slot

Cycle to produce any number of circumferential grooves on the end face or the peripheral surface

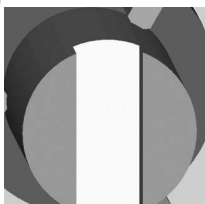

Open slot

Cycle to produce open grooves on the end face or the peripheral surface using the vortex milling or plunge cutting technologies

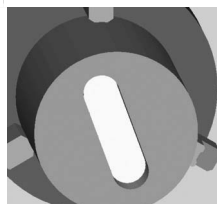


Elongated hole

Cycle to produce elongated holes on the end face or the peripheral surface

■ Only in
programGUIDE

Thread milling

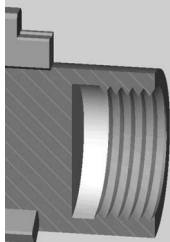

To produce internal or external threads on the end face or the peripheral surface using the milling technology

Engraving







Engraving cycle for characters and numbers on the end face or the peripheral surface with any alignment


3.8 Contour milling

This section provides an overview of the contour milling cycles in the ShopTurn machining step programming and programGUIDE. The contour milling with ShopTurn machining step programming and programGUIDE is explained as an example.




3.8.1 Overview of the milling cycles for the contour machining

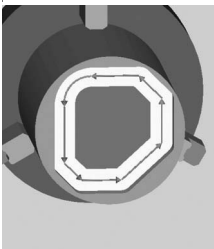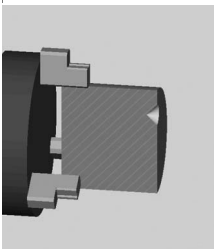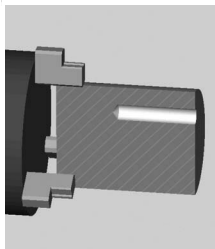Path milling			
		Cycle for machining arbitrary contours by milling along the contour path on the end face or the peripheral surface	
Rough drill			
			
Centering	Rough drill		
Cycle for centered drilling for the specific predrilling of a start hole for pocket milling	Cycle for drilling for the specific predrilling of a start hole for pocket milling		

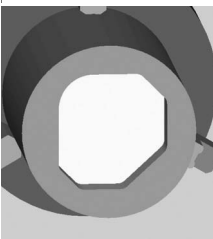Pocket ▶	or	Pocket res.mat. ▶
	<p>Cycle for machining any pocket contours on the end face and the peripheral surface; it can be combined with automatic residual material detection</p>	

Spigot ▶	or	Spigot res. mat. ▶
	<p>Cycle to produce any spigot contours with a defined initial blank on the end face and the peripheral surface; it can be combined with automatic residual material detection</p>	

3.8.2 Contour milling with ShopTurn machining step programming

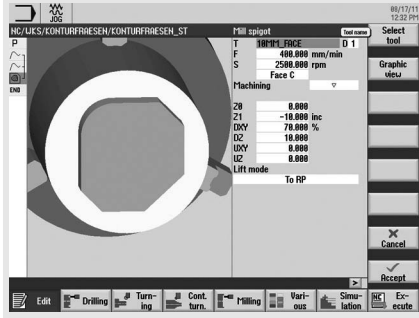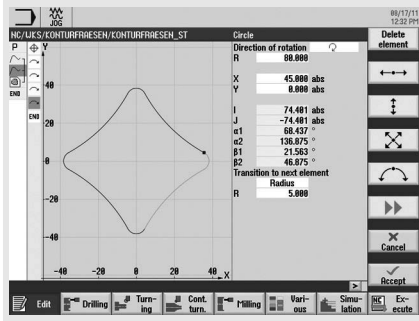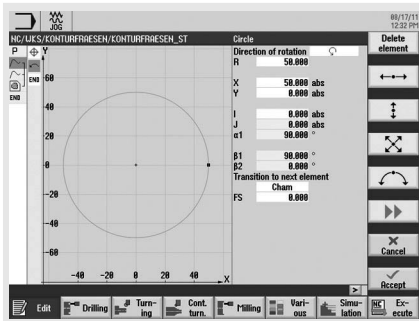

You can define open contours or closed contours (pockets, islands, spigots) and machine them with path milling or milling cycles.


In the example, a raw and finished part contour is created in the contour calculator. Contours for spigots must be closed. ShopTurn interprets the first specified contour as a blank contour and all others as spigots.

You can enter as many as 256 geometric elements.

Note: Contours can be renamed.



Define whether the contour is to be created on the end face or the peripheral surface.

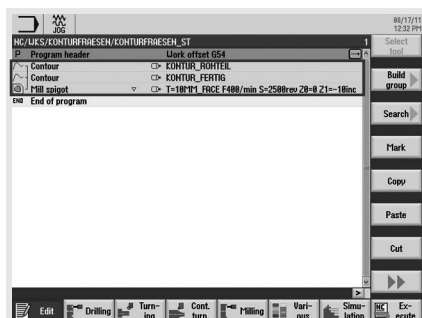

The contours and the milling cycle are linked in the machining step editor.

3.8.3 Contour milling with programGUIDE

The contour call for the unmachined and finished part and the call for the “Mill spigot” milling cycle are explained using the following example program.

08/17/11
12:32 PM

NC/UKS/KONTURFRAESEN/KONTURFRAESEN_PG 1

G54

SETMS(1)

G0 G53 X400 Z400

WORKPIECE(, , , "CYLINDER", 192, 0, -200, -100, 100)

T="10MM_FACE" D1

M6

SETMS(2)

G94 S2500 M3

G0 X110 Z10

F400

TRANSMIT

1. CYCLE62("KONTUR_ROHTEIL", 1, ,)

2. CYCLE62("KONTUR_FERTIG", 1, ,)

3. CYCLE63("TEMP1", 1, 10, 0, 1, -10, 400, , 70, 10, 0, 0, 0, 0, , , 1, 2, , , 0, 201, 111)

TRAFOOF

G0 G53 X400 Z400

M30

E_LAB_A_KONTUR_ROHTEIL: ; #SM Z: 2

G17 G00 DIAMODE *CD*

Edit Drilling Turning Cont. turn. Milling Various Simulation NC Execute

1. Contour call, blank

2. Contour call, finished part

3. Contour milling

- For the machining on the end face, activate the TRANSMIT function; for machining operations on the peripheral surface, activate the TRACYL function. TRAFOOF deselects the transformations again.

You have the following ways of including a contour call in a programGUIDE program:

The contour is contained in the main program directly behind M30

Contour call

CON

Contour name

The contour is contained in a subroutine

Contour call

PRG

Subprogram

The contour is contained in the main program between two labels

Contour call

LAB1

LAB2

Labels

Call using labels in a subroutine

Contour call

PRG

LAB1

Labels in subprogram

Contour call

CON

Contour name

KONTUR_ROHTEIL

Contour call

CON

Contour name

KONTUR_FERTIG

Mill.




Cont. mill.

Contour

Contour call

First insert the contour calls at the desired location in the program.

Note the above figure for contour calls.

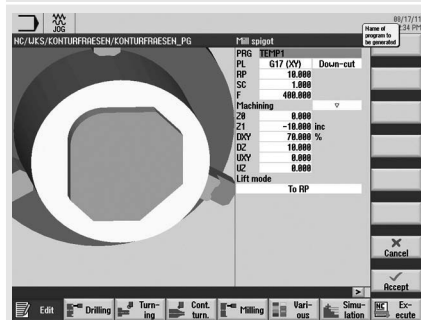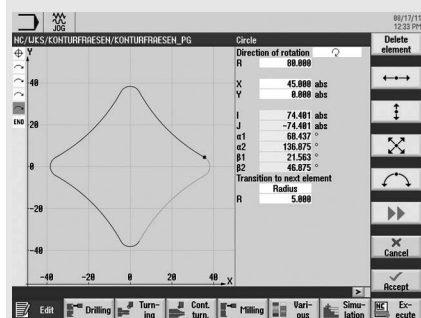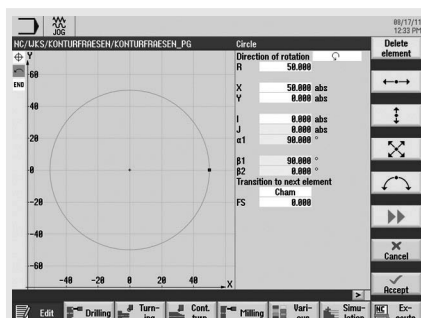

Create the unmachined and finished part contour in the contour calculator.

■ You can enter as many as 256 geometric elements.

■ **Note:** Contours can be renamed.




Enter the name for a program to be generated and select the machining plane. The program names can be chosen freely.

During the program execution, the G codes for the stock removal or the milling of contour elements using CYCLE952 (contour turning) or CYCLE63 (contour milling), including the residual material removal, will be generated in the program described above. Since these are normal NC programs, you can continue to use them, for example, to use the calculated code for a cycle-free and thus faster program.

3.9 Counterspindle

If your lathe has a counterspindle, you can machine workpieces using turning, drilling and milling functions on the front and rear faces without reclamping the workpiece manually.

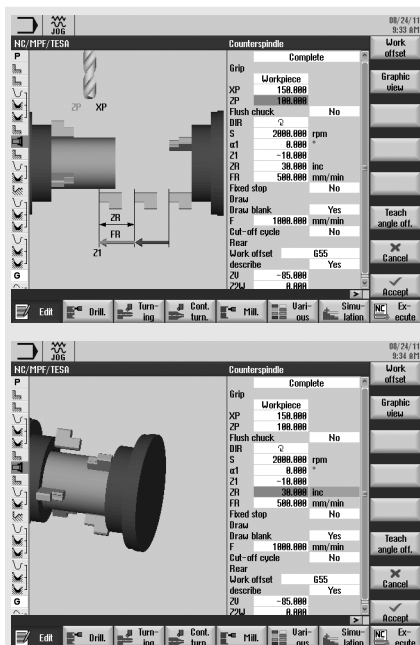

- Z2W is the position of the counterspindle on which machining is performed after the transfer. For the first workpiece, move as far right as possible!

ZV is the workpiece length dimension specified on the drawing.
Caution! negative value.




The cycle and contour definition support is identical to that for machining with the main spindle; the Z axis values are simply mirrored.

A dialog provides support for the transfer of the main spindle to the counterspindle. You can choose between the following options for the transfer:

- Gripping: Grip the workpiece with the counterspindle
- Withdrawing: Withdraw the workpiece from the main spindle with the counterspindle
- Rear face: Move the workpiece with the counterspindle to the new machining position
- Complete: Grip, withdraw (optionally with cutting-off) and rear face steps
- Front face: Zero offset for machining the next front face (for bars)

- Refer also to the information about the setting data in the Tool measurement section.

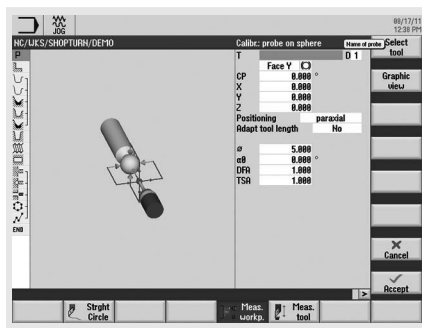

Meas.
workp.

Calibrate
probe

Comp.
to sphere


Using this measuring variant, a workpiece probe can be calibrated at any position in space.

3.10.2 Example

The following example for ShopTurn illustrates the use of the measuring cycles.



Sample program with measuring cycles in the machining step editor.

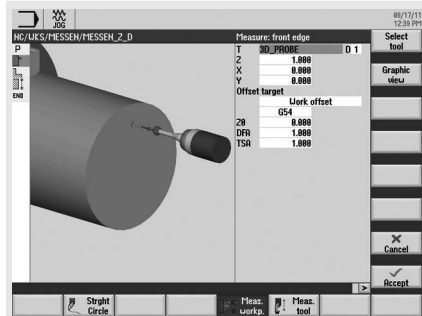


Meas.
workp.


Measurem.
turning

[Icon]

To automatically determine the workpiece zero at the program start and to write the zero offset, the "Measure front edge" cycle is used in this example.

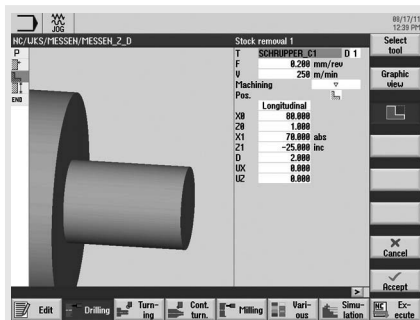

Turn a 70-mm diameter with the stock removal cycle.

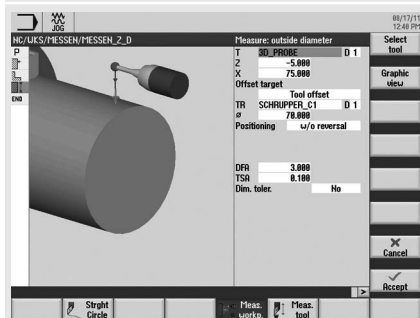

Automatic measuring of the D70 diameter with the "Measure external diameter" cycle. Any deviations of the specified dimension are automatically written in the wear parameter of the tool and so compensated.

4 Milling technology


In addition to the guidelines for setup and programming, this chapter provides an overview of the technology cycles for drilling, milling and contour milling. You also obtain information on functions such as cylinder surface transformation, unmachined part input for simulation, swivel plane, high-speed settings and an overview of the cycles for the in-process measurement.



4.1 Setting up

In addition to the guidelines for setup and programming, this chapter provides an overview of the technology cycles for drilling, milling and contour milling. You also obtain information on functions such as cylinder surface transformation, unmachined part input for simulation, swivel plane, high-speed settings and an overview of the cycles for the in-process measurement.

4.1.1 Setting the zero point

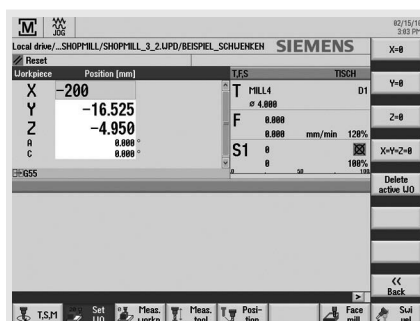


In the “Set ZO” dialog box, you can write direct position values for individual axes in the actual value display.

The difference between the position value in the machine coordinate system (MCS) and the workpiece coordinate system (WCS) is saved in the active zero offset.

■ **Requirement:** A zero offset must be active.

■ **Note:** The “Set WO” function is also possible in the STOP state.

4.1.2 Workpiece zero

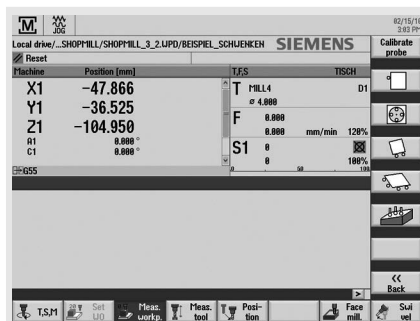

Note: Information about logging measurement results is provided in Chapter "Logging measurement results in JOG".




The reference point for programming a workpiece is always the workpiece zero. You are guided graphically for setting the workpiece zero.

You can perform the measurement using edge finders, dial gauges, reference tool or switching 3D button.

The following measuring variants are available for selection:

- Calibrate probe calibration length/ diameter
- Measuring point/edge/rib, align edge at 2 points
- Measure perpendicular/any corner
- Measure rectangular/circular pocket
- Measure/align at 2, 3 or 4 holes
- Measure rectangular/circular spigot
- Measure/align at 2, 3 or 4 spigots
- Align measuring plane in conjunction with multi-axis machines

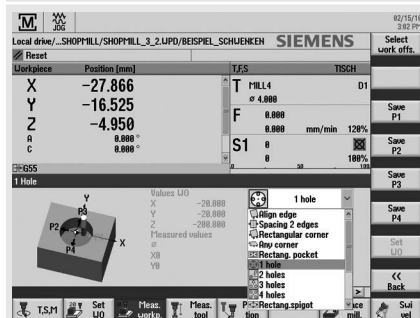

You can select favorites for the measuring variant starting at the third softkey of the vertical softkey bar. To do so, press the softkey to which you want to assign the desired measuring variant. Open the selection list with any key and accept the desired measuring variant (see figure) with the Input key.

4.1.3 Tool measurement



Note: Information about logging measurement results is provided in Chapter "Logging measurement results in JOG".




You are guided graphically for calibrating the tools (all tool types).

The tool compensation value can be directly determined in the machine set-up.

The following versions are available for determining the compensation values of the tools:

- Manually measure the length/diameter
- Automatically measure the length/diameter (cycle for switching measuring boxes)
- Fixed-point calibration of probe/adjustment

4.1.4 Face milling

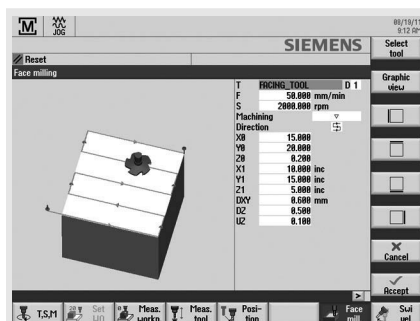


To prepare the blank for machining, a face milling cycle is provided in setup mode. You can select the tool directly from the tool list.

In addition to the input of the feedrate and the spindle speed or cutting speed, you can specify the machining strategy and direction as well as the machining limitation.

Because the input values are retained even after the power has been switched off and on, the user can restart the face milling operation with minimum effort.


4.1.5 Swiveling in JOG

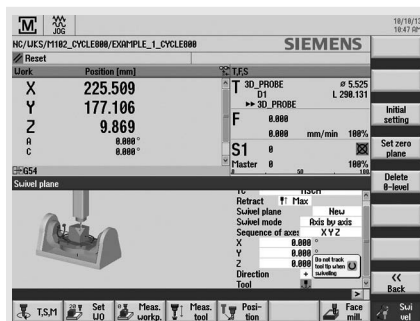

The swivel function (JOG) gives you the capability of swiveling a machining plane as required:

- Machining inclined surfaces
- Measure with approached axes


Animated elements provide support for the direction selection:

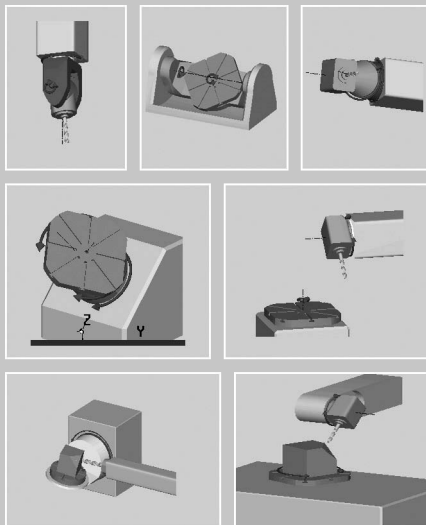

You can swivel directly and axis-by-axis, including an optional coordinate rotation.

Note: Support is provided for all common machine kinematics!

4.2 Manual Machine

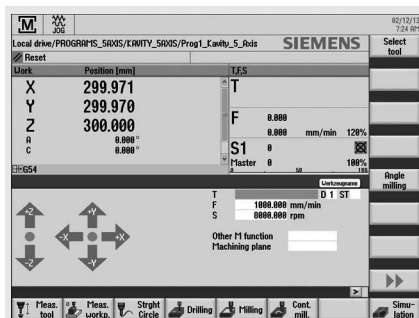

Note: Overviews of the drilling, milling and contour-milling cycles are contained in Section 4.3, Programming.

All important machining actions can be performed in the Manual Machine operating area without an associated part program needing to be created.

The following functions are available:


- Measure tool
- Traverse axes
- Set zero offset (ZO)
- Turn straight line / circle
- Drill, such as centering, deep-hole drilling, thread cutting
- Mill, such as face milling, pocket milling, multi-edge stud milling
- Mill contours

User-friendly input screens with help screens and animated elements are available for parameterizing the cycles.


4.3 Programming

4.3.1 ShopMill machining step programming

Each program line in the ShopMill machining step editor represents a technological machining step (example: face milling, thread milling, ...) or geometric data required for the machining steps (position patterns or contours). You do not need any knowledge of DIN/ISO for entering the individual machining steps. All required technical and geometric parameters are entered in cycle screen forms. If necessary you can also enter DIN/ISO blocks and control functions in the machining step editor.

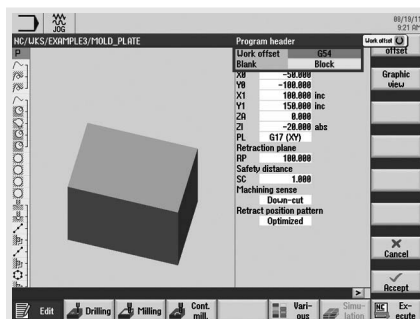

In the program header, you define program parameters such as the blank and the zero offset.

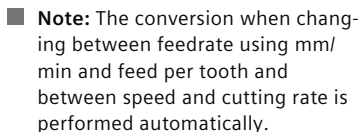


The technology data such as the tool call, the feedrate via mm/min or feed per tooth (including automatic conversion) and the speed or the cutting rate (including automatic conversion) is integrated directly in the cycle.

You can also enter parameters in the input fields of the cycles.



During the programming, you can use the "Graphic view" function to dynamically display the workpiece.

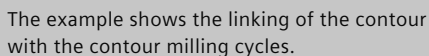

4.3.2 programGUIDE (G-Code)

In programGUIDE, in addition to the DIN/ISO editor, the technology cycles are also available similar to the ShopMill machining step programming. This ensures an optimum integration. The calls for tool, feedrate and cutting rate, etc. are also entered in the DIN/ISO editor. The following figure shows the structure of a program.

08/19/11
9:23 AM

Local drive/my_operate/Opener_programGuide_short

1 CYCLE800(1, "TISCH", 100000, 57, 0, 0, 0, 0, 0, 0, 0, -1, 100, 1)¶
LONGHOLE(100, 0, 1, , 5, 1, 10, 0, 0, 5, 30, 0, 0.1, 0.1, 0.5, 3, 0, 100, 1011, 1)¶
G54¶

1. WORKPIECE(, , , "BOX", 48, 0, -20, -80, -15, 15, 75, -45)¶

2. T="FRAESER_10"¶
M6¶
S8000m3¶
G54¶

4. G0 x37.5y-22.5 z2¶
CYCLE62("AUSSENKONTUR_OBEN", 1, ,)¶
CYCLE62("OEFFNER1", 1, ,)¶
CYCLE62("OEFFNER2", 1, ,)¶

5. CYCLE63("opener", 1, 100, 0, 1, -10, 2000, 2000, 50, 5, 0.1, 0, 0, 0, 2, 2, 15, 1, 2, , ,)¶
T="FRAESER_8"¶
M6¶
S8000m3¶
CYCLE63("opener_rest", 1, 100, 0, 1, -10, 2000, , 50, 5, 0.1, 0.1, 0, 0, 0, , , , , "FRAESER_8"¶
M30¶
E_LAB_A_AUSSENKONTUR_OBEN: ; #SM 2: 7¶
G17 G90 DIAMOF; *GP*¶
G0 X 4.5 Y 10.5 Z 0.5 *GP*

Edit Drilling Milling Cont. mill. Turning Various Simulation Execute


1. Program header/blank input

2. Tool call

3. Technology block

4. Approach


5. Cycle call

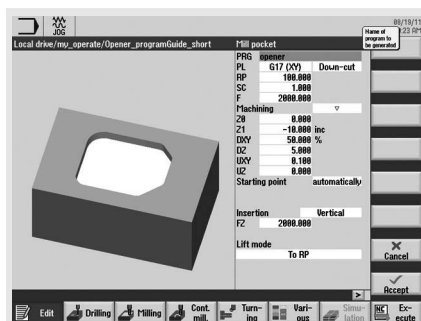



The example shown here uses the “Mill pocket” technology cycle from above (see CYCLE63 cycle call).


4.4 Drilling cycles

An overview of the drilling cycles in ShopMill and programGUIDE with application tips is shown below.

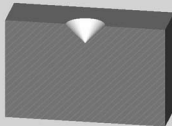Centering			
	Cycle for centering at any positions/ position patterns		

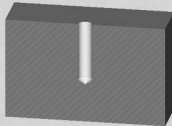
Drilling Reaming			
			
Drilling	Reaming		
Cycle for drill holes in an infeed with drilling depth based on the shank or tip at any positions/position patterns	Cycle for reaming at any positions/ position patterns		

Deep hole drilling

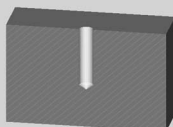

Deep hole drilling 1

Cycle for holes with drilling depth referred to the shaft or tip at any positions/ position patterns

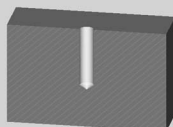


Deep hole drilling 2

Cycle for holes with drilling depth referred to the shaft or tip at any positions/ position patterns - with extended drilling strategies, for example pilot holes or soft first cut.


The use of deep hole drills (gun drills) is supported.

Boring

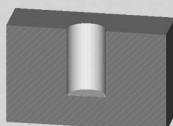


Cycle for boring drill hole diameters with special boring tools at any positions/ position patterns

Thread

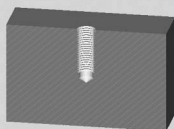

Tapping


Cycle for tapping with and without compensating chuck at any positions/position patterns

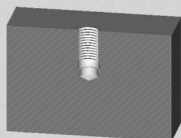


Drill+thrd milling

Cycle for producing a thread with special tapping drill and thread milling cutters at any positions/position patterns


Positions

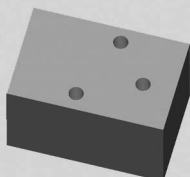


Cycle for the input of free positional data

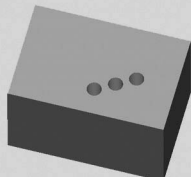


Cycle to enter a series of positions

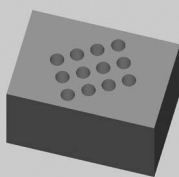


Cycle to enter any number of positions with the same spacing on a grid

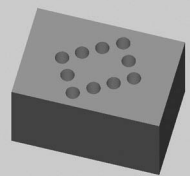


Cycle to enter any number of positions with the same spacing on a frame

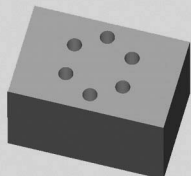

Cycle to enter circles of holes

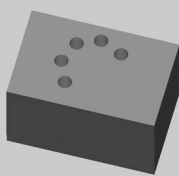


Cycle to enter positions along an arc with a defined radius.

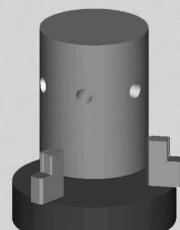


Display rotary axis in the position patterns

4.5 Milling cycles


An overview of the milling cycles in the ShopMill machining step programming and programGUIDE with application tips is shown below.

Face milling	
	You can use this cycle to face mill any workpiece. A rectangular surface is always machined.

You can optionally select the limits using the appropriate softkeys. You can select a maximum of three limits in combination, otherwise use the pocket milling cycle.

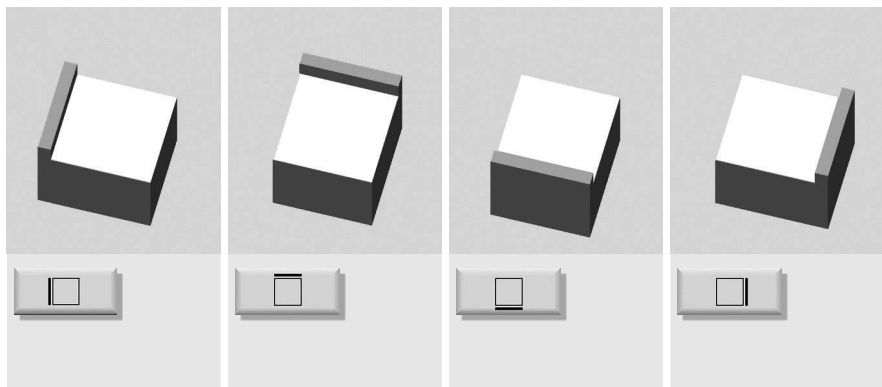

Pocket

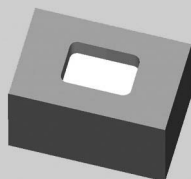

**Rectang.
pocket**

Cycle to produce any circular pocket at any positions or position patterns.

Machining methods:


Roughing, finishing, chamfering

Infeed:

Plane-by-plane, helical

Insertion strategies:

Vertical, helical, predrilled

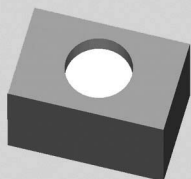

**Circular
pocket**

Cycle to produce a circular pocket at any positions or position patterns.

Machining methods:

Roughing, finishing, chamfering


Infeed:

Plane-by-plane, helical

Insertion strategy:


Vertical, helical.

Multi-edge spigot

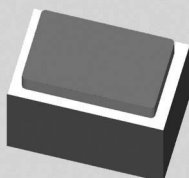


Rectang. spigot

Cycle for producing a rectangular spigot at any positions/position patterns

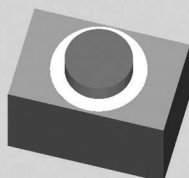

Circular spigot


Cycle for producing a circular spigot at any positions/position patterns

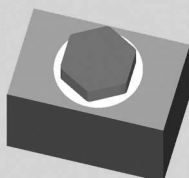

Multi- edge


Cycle for producing a polyhedron at any positions/position patterns

Slot

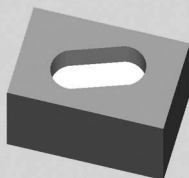

Longit. slot

Cycle for producing longitudinal grooves with vertical, helical and oscillating insertion strategies at any positions/position patterns

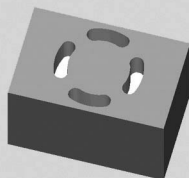


Circumfer. slot

Cycle to produce any number of circumferential grooves on a graduated circle or full circle



Open slot

Cycle for producing open grooves with the vortex milling or plunge cutting technologies at any positions/position patterns

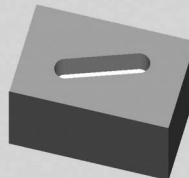

Elongated hole


Cycle for producing elongated holes

Machining types:

Plane-by-plane,
oscillating


■ Only in
programGUIDE

Thread milling

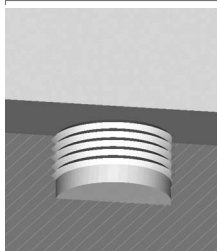

Cycle for producing internal or external threads with the milling technology at any positions/position patterns

Engraving



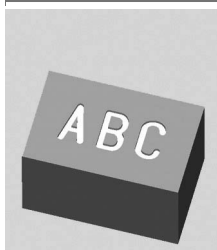


Engraving cycle for characters and numbers with any alignment

4.6 Contour milling

This section provides an overview of the contour milling cycles in the ShopMill machining step programming and programGUIDE. The contour milling with ShopMill machining step programming and programGUIDE is explained using an example.


4.6.1 Overview of the milling cycles for the contour machining

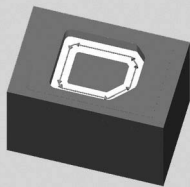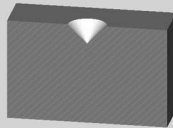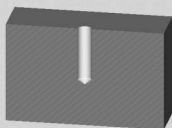Path milling			
		Cycle for the machining of arbitrary contours, incl. radius compensation and approach/departure movements	
Rough drill			
			
Centering	Rough drill		
Cycle for centered drilling for the specific predrilling of a start hole for pocket milling	Cycle for predrilling for the specific pre-drilling of a start hole for pocket milling		

Pocket

or

Pocket
res.mat.

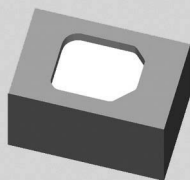


Cycle for machining any pocket contours, with helical and oscillation insertion strategies; it can be combined with automatic residual material detection

■ **Note:** Manual Machine does not support residual material detection.

Spigot

or



Spigot
res. mat.

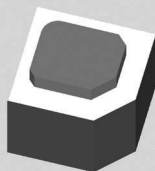

Cycle to produce any spigot contours with a defined initial blank; it can be combined with automatic residual material detection

■ **Note:** Manual Machine does not support residual material detection.

4.6.2 Contour milling with ShopMill machining step programming

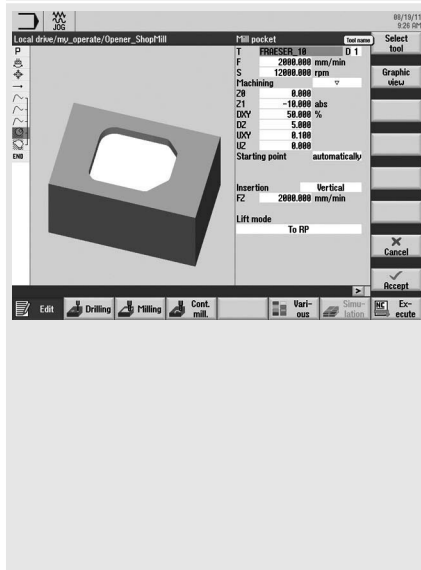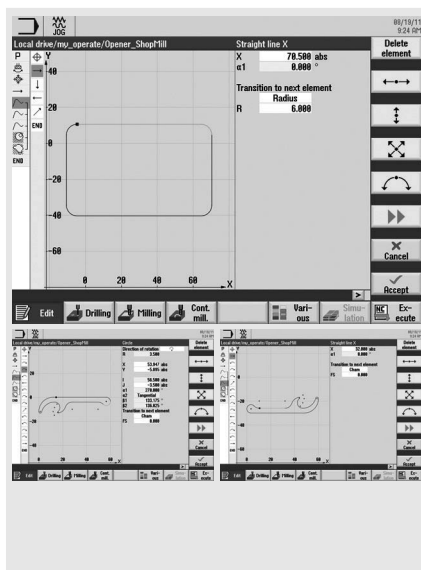

You can define open contours or closed contours (pockets, islands, spigots) and machine them with contour milling cycles.


The example shows the creation of a contour pocket and two contours for the islands. This allows you to easily cut the surface/pocket outside the islands.

■ You can enter as many as 256 geometric elements.

■ **Note:** Contours can be renamed.




In the "Mill pocket" technology cycle, you create the tool, the feedrate, the spindle speed, as well as the complete machining and insertion strategy, etc.

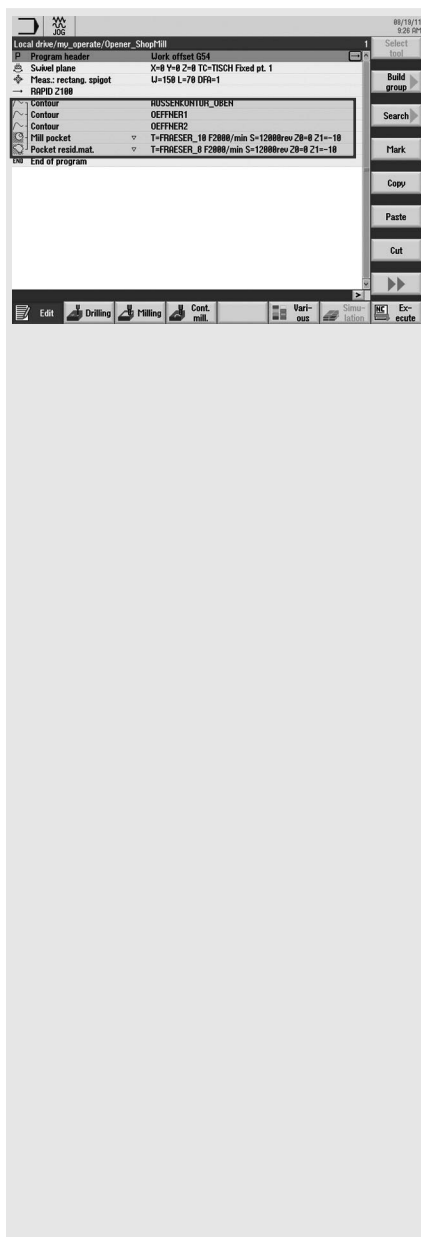

The contours and the “mill pocket” and “pocket residual material” milling cycles are linked in the machining step editor.

4.6.3 Contour milling with programGUIDE (G-Code)

The following example program explains the contour call for the pocket and the islands and the call of the “Mill pocket” milling cycle.

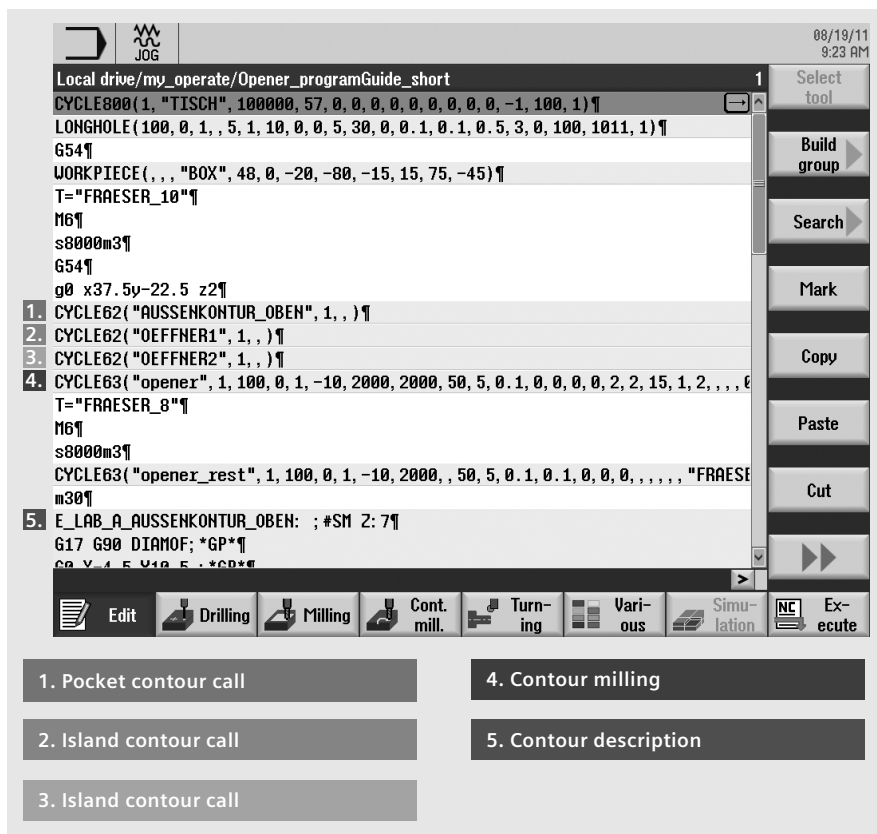

Contour call	
	Contour name
CON	RUSSENKONTUR_OBEN


Contour call	
	Contour name
CON	OEFFNER1

Contour call	
	Contour name
CON	OEFFNER2



First insert the contour calls at the desired location in the program.


Note the above figure for contour calls.

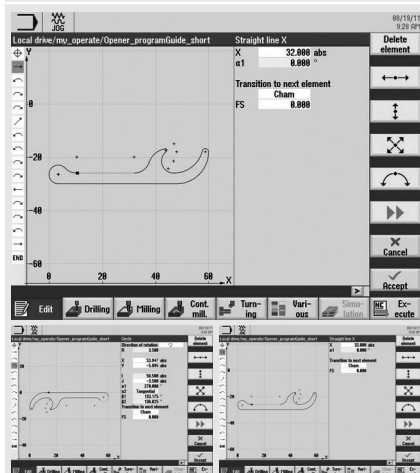

Create the pocket and the island contours in the contour calculator.

- You can enter as many as 256 geometric elements.

- **Note:** Contours can be renamed.

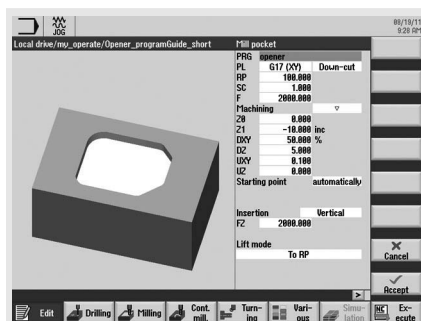


Enter the name for a program to be generated and select the machining plane. The program names can be chosen freely.

During the program execution, the G codes for the milling of contour elements using CYCLE952 (contour turning) or CYCLE63 (contour milling), including the residual material removal, will be generated in the program described above. Since these are normal NC programs, you can continue to use them, for example, to use the calculated code for a cycle-free and thus faster program.

4.7 Miscellaneous


The “Miscellaneous” softkey provides the following functions

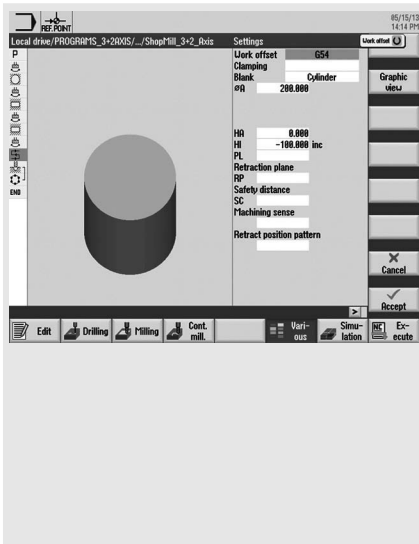

Settings ShopMill only


All parameters defined in the program header, with the exception of the dimension unit, can be changed at any location in the program.

The settings in the program header are modal, i.e. they remain active until they are changed.

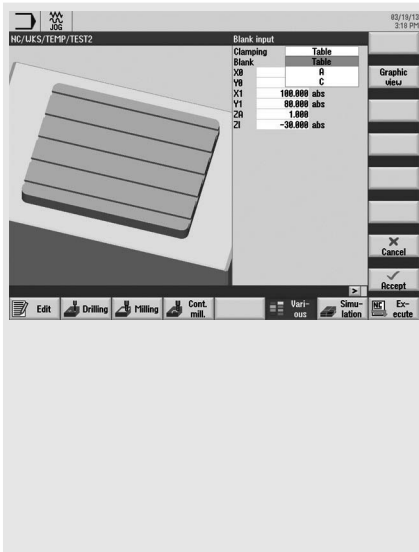

Blank programGUIDE only

The “Blank input” cycle can be used in programGUIDE to enter the blank data. You select here the form of the raw part and the clamping, etc.

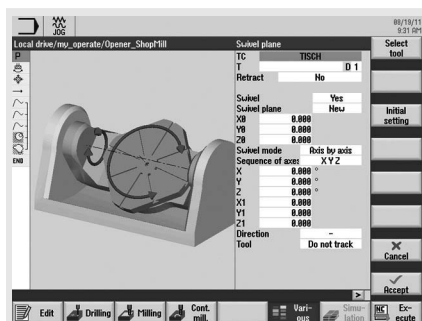

Swivel plane

The CYCLE800 swivel cycle is used to swivel to any surface in order to either machine or measure it. In this cycle, the active workpiece zeros and the zero offsets are converted to the inclined surface taking into account the kinematic chain of the machine by calling the appropriate NC functions, and rotary axes (optionally) positioned.

To set and align the tool, call the "Swivel tool" function.


HighSpeed Settings

When machining free-form surfaces, there are high requirements regarding velocity as well as precision and surface quality. The “High speed settings” cycle simplifies parameterizing mold-making applications.

- **Note:** Depending on the particular configuration, using the cycle screen form in the selection field, you can select between “Advanced Surface” and “Top Surface” – or the best available mold-making function is automatically used.

Advanced Surface

Using the “High Speed Settings” cycle, “Advanced Surface” option, you can simply parameterize the optimum velocity control as a function of the particular machining type (roughing, prefinishing and finishing).

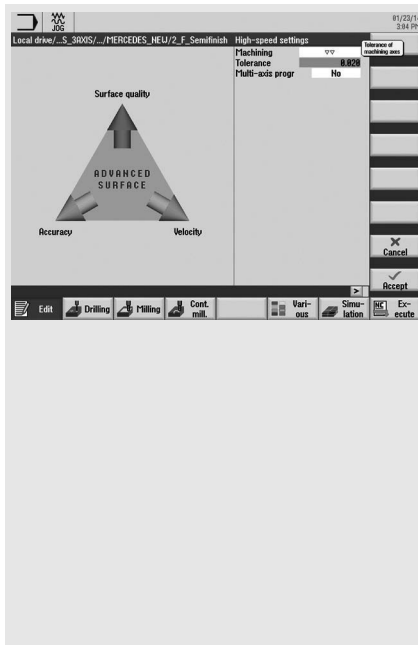


For Advanced Surface, you define the following settings:

- Tolerance of the machining axes
- Machining type
 - Finishing
 - Prefinishing
 - Roughing
 - Deselection (default setting)
- Multi-axis program, yes/no

Top Surface

The “High Speed Settings” cycle, “Top Surface” option allows significantly better workpiece surfaces to be achieved for inclined line-by-line milled finishing programs, for “poor” data quality and/or irregular point distribution in NC programs from the CAD/CAM system. “Top Surface” is available as an option.

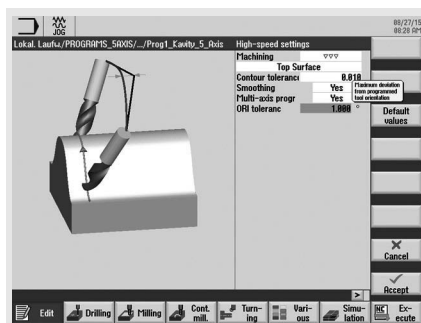


In addition to selecting the machining types (finishing, prefinishing, roughing), in the extended screen form for “Top Surface”, you define the following settings:

- Smoothing, yes/no
- Multi-axis program, yes/no
- Contour and orientation tolerance (default values)



Note: Depending on the particular configuration, using the cycle screen form in the selection field, you can select between “Advanced Surface” and “Top Surface” – or the best available mold-making function is automatically used.

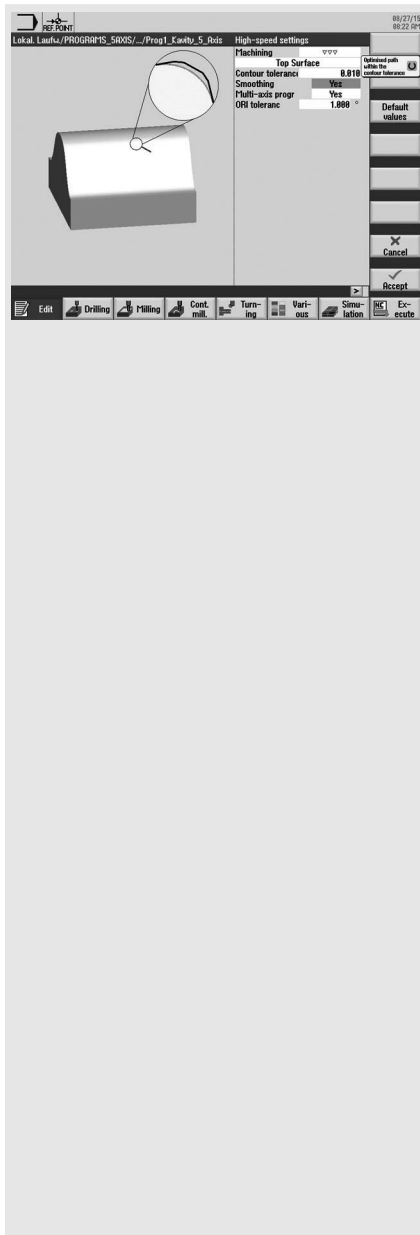


- The contour tolerance is shown as magnifying glass.

Default values:

- Roughing 0.1
- Prefinishing 0.05
- Finishing 0.01
- The smoothing is also shown as magnifying glass
 - With smoothing, the surface becomes shiny
 - Without smoothing, the tolerance comes closer to the contour.


Transformations

You can use the following functions under ShopMill:

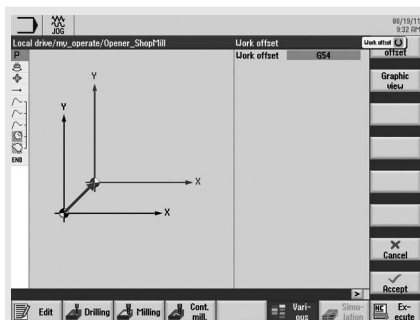


Work offset

You can call zero offsets (G54, etc.) from any program.

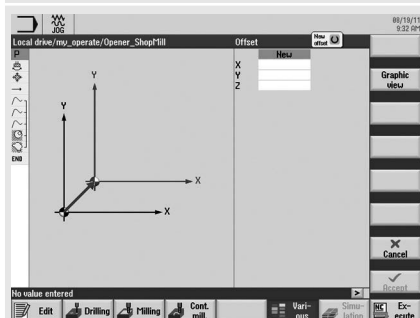


Offset

For each axis, you can program an offset of the zero point.

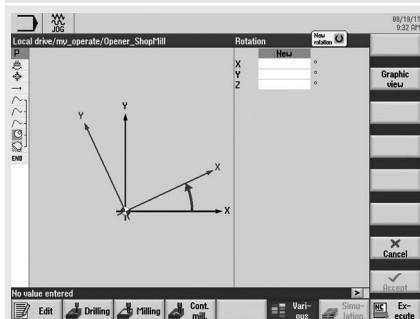


Rotation

You can rotate every axis through a specific angle. A positive angle corresponds to counterclockwise rotation.

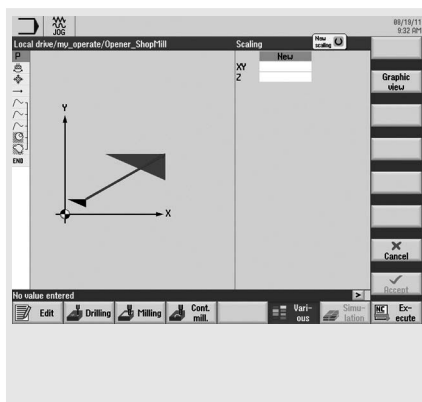


Scaling

You can specify a scale factor for the scaling in X/Y/Z. The programmed coordinates are then multiplied by this factor.

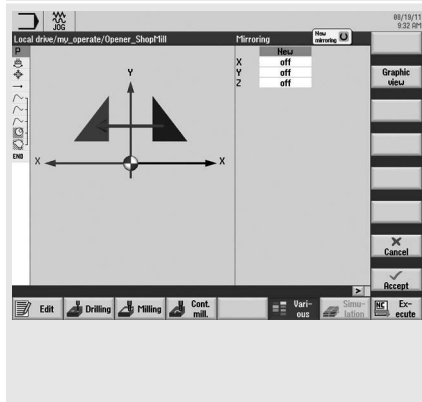

Mirroring

You have the option of mirroring all axes. Enter the axis to be mirrored in each case.

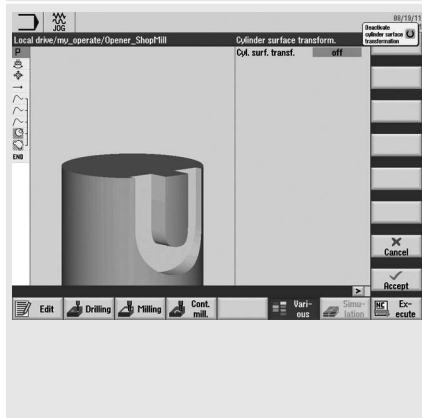

Cylinder surface


You can use this function to mill parallel-sided grooves with and without groove side offset.

4.8 Measuring in the Automatic mode – in-process measurement

For measurement tasks in automatic mode, powerful measuring cycles are available for both ShopMill and programGUIDE. Input screens with dynamic help displays are used for convenient entry of the measuring parameters.

4.8.1 Measure workpiece

The figure below provides an overview of the measuring variants.

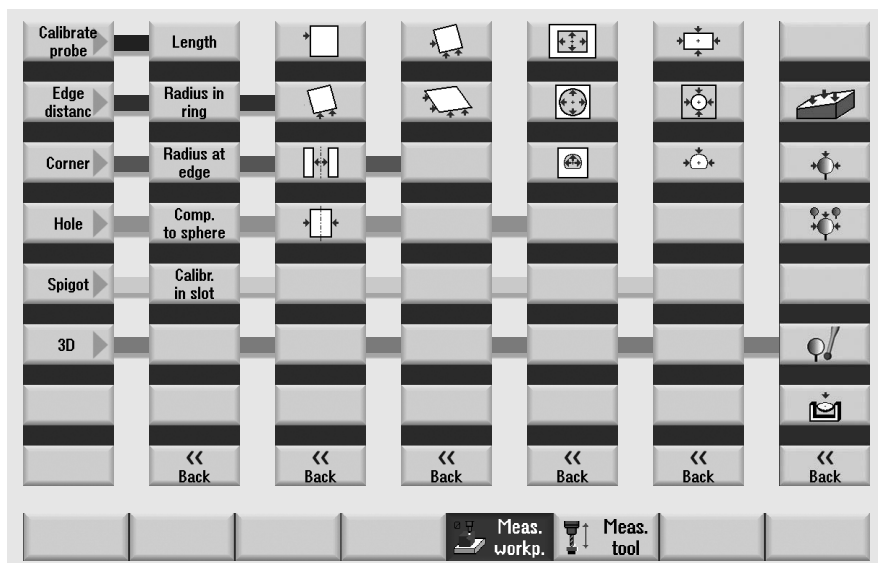


Measuring cycles for workpiece probe for the milling technology:


- Calibration – length, radius in ring, radius at edge, trim to sphere, alignment in groove
- Measure edge – point/surface, align edge, groove/rib distance,
- Measure corner – right-angled corner with 3 points or any corner with 4 internal/external points
- Measure drill holes – circle segment with 4 or 3 points – rectangular pocket
- Measure spigots – circle segment with 4 or 3 points – rectangular
- Measure 3D – align plane - sphere

Applications: Measuring only, zero offset, tool offset

■ **Note:** The CYCLE 995 and CYCLE 996 measuring cycles are available in conjunction with the “Measure kinematics” option.

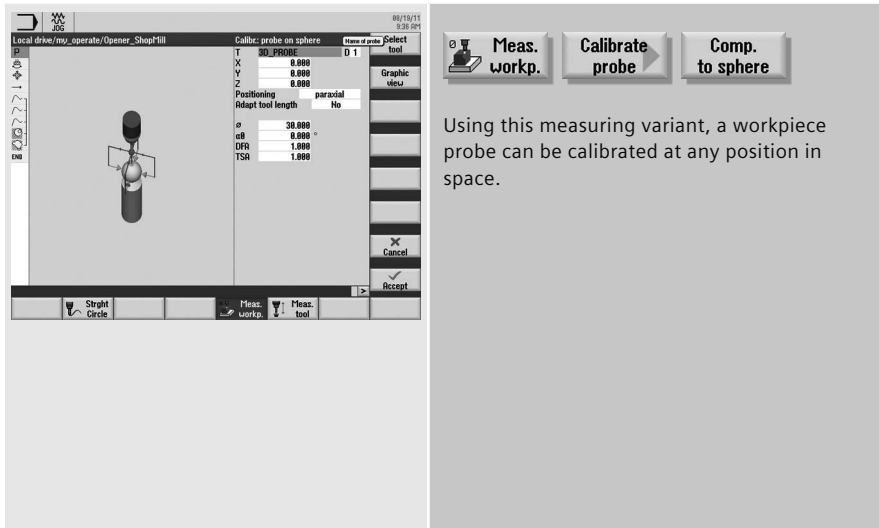

4.8.2 Measure tool

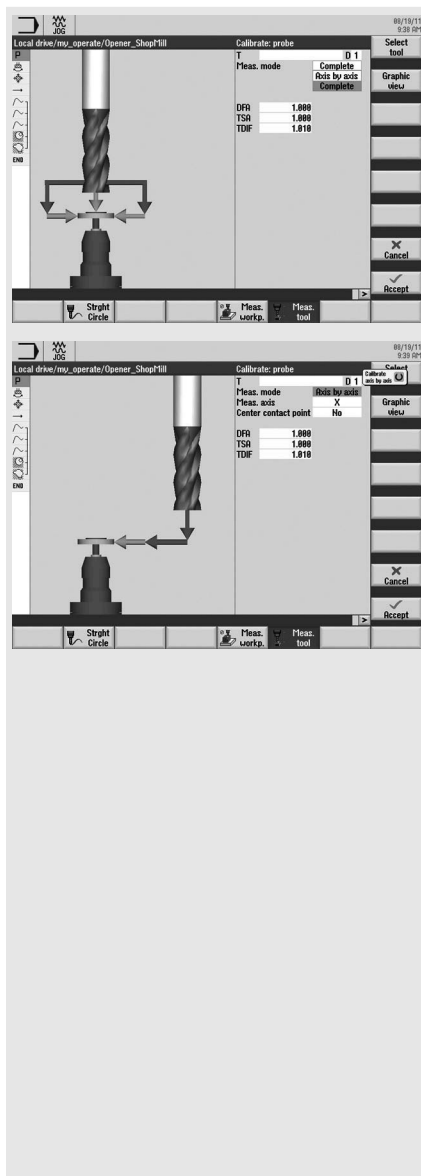

The following measuring cycles for measuring with measuring box are available for selection:

- Calibration: Length, radius, complete
- Measure: Length and radius
- Measure with rotating or stationary spindle
- Tool offset in geometry or wear
- Measure in machine MCS or workpiece WCS coordinate system



Note: Information about logging measurement results is provided in Chapter “Logging measurement results in the automatic mode”.

5 Multitasking (with SINUMERIK 840D sl)

This chapter contains useful information regarding the machining of workpieces on multitasking machines. This includes the extended tool management, multi-axis kinematics, turning functionality for milling (milling-turning technology) as well as milling functionality for turning (turning-milling technology).



5.1 Tool management

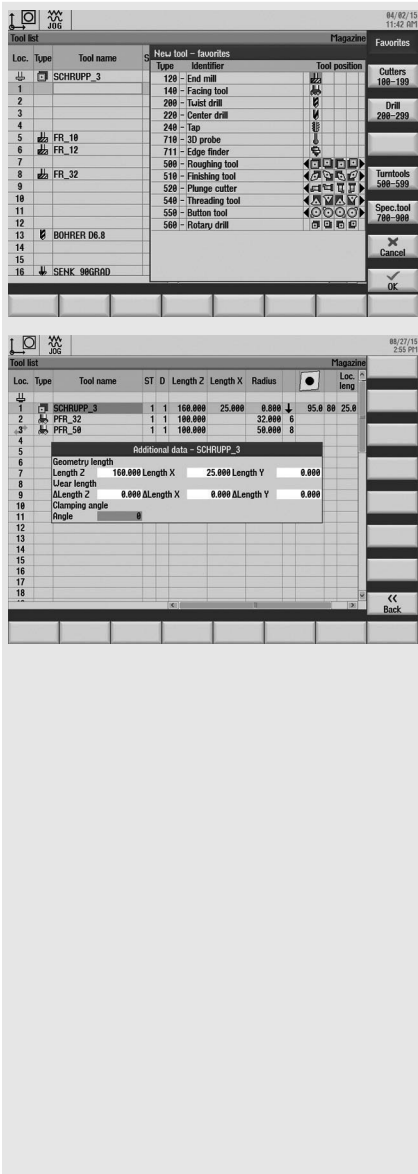


For multitasking machines – for turning-milling or milling-turning – extended tool management is available for turning and milling tools.

For milling-turning technology, turning tools are automatically displayed. You can enter tool-specific basic rotation for turning tools in the Extended data dialog.

In addition to turning and milling tools you can also use complex tools such as multitools. For multitools, there are additional parameters, for example defining clearances using the location number or angle and different tool types per location. All tools are shown as icons.

5.2 Turning-milling technology with ShopTurn and programGUIDE


5.2.1 Swivel axis in TSM-mode

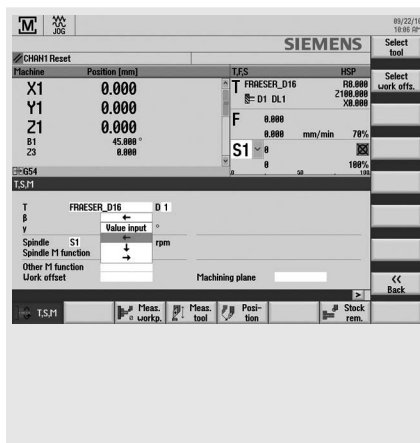

In TSM-mode, you can control the swivel axis by entering a value or with the direction arrows.

You can approach the β angle (B axis position) and the γ angle (tool spindle position) using input parameters, e.g. to manually set the zero point or calibrate the tool.

5.2.2 Turning with ShopTurn and B axis

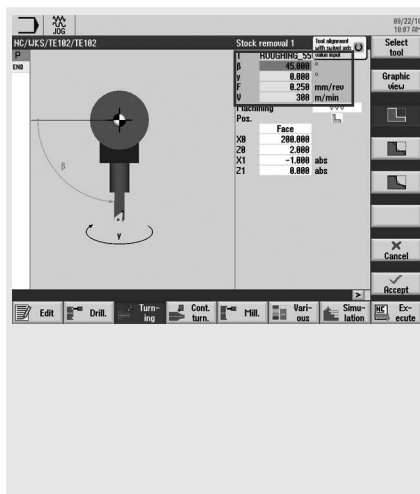


e.g.




In all turning cycles under ShopTurn, enter the setting angle of the B axis (β) and the positioning angle of the tool spindle (γ) directly in the technology area of the cycle. Use the γ angle to specify whether a tool operates as standard or overhead.

5.2.3 Turning with programGUIDE and B axis

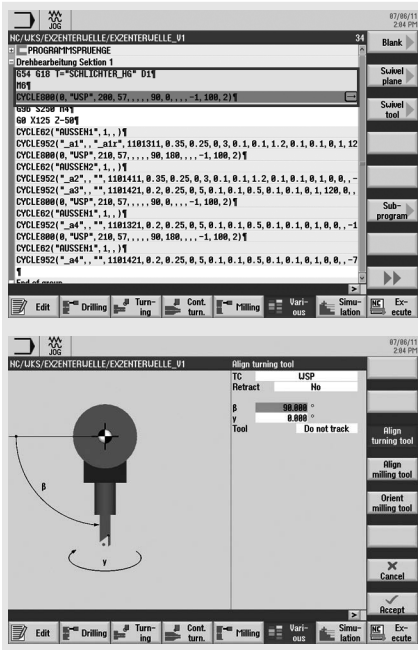


You can use the “Align turning tool” function to align the turning tool in the CYCLE800. You can then program the turning.

5.2.4 Milling with ShopTurn and B axis

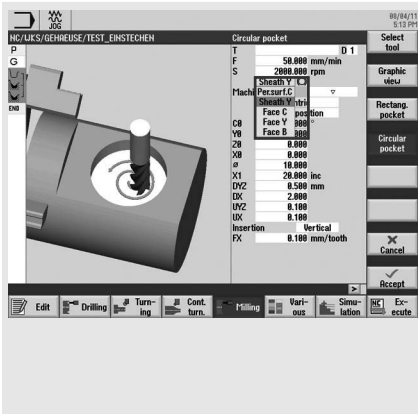


All milling cycles on the lathe are identical with those in the ShopMill machining step programming.

You define in the cycle the selection of the plane when milling on the end face or the peripheral surface.

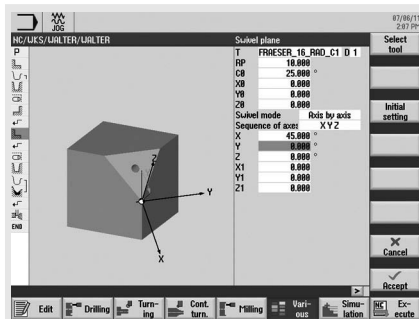

For milling on swiveled planes, use the CYCLE800 swivel cycle on the turning machine.


Note: The first choice is normally YXZ, according to the hardware, for the axis sequence. Turning around the Y axis!

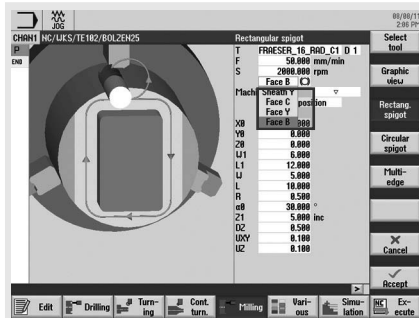

In the milling cycle, then select the "Face B" plane for the combination with swiveling.




5.2.5 Milling with programGUIDE and B axis

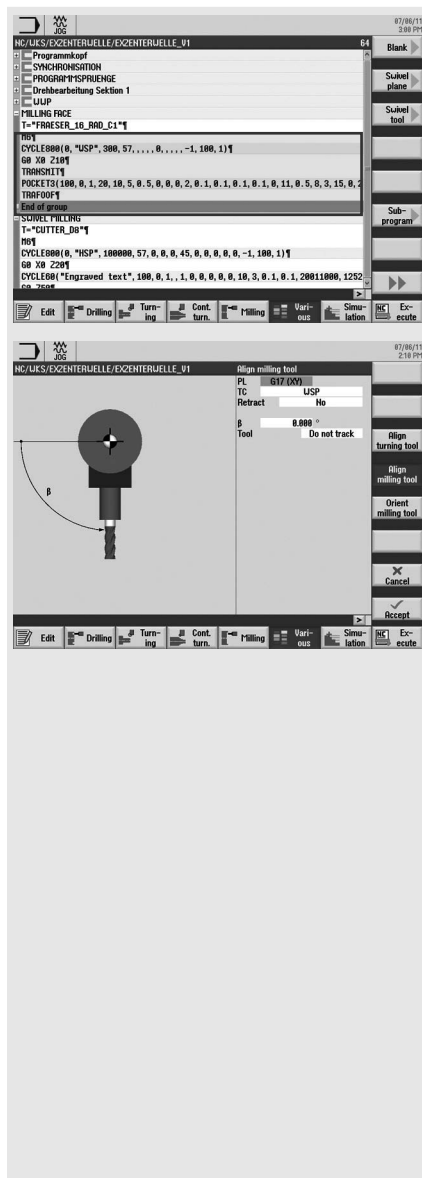

You use the "Align milling tool" function to position the milling tools for machining on the end face or peripheral surface.

- **Note:** The alignment of the milling tool causes, however, only a swivel of the B axis and the calculation of the tool tip, but no swivel of the plane!

You can then program on the end face, for example with TRANSMIT.

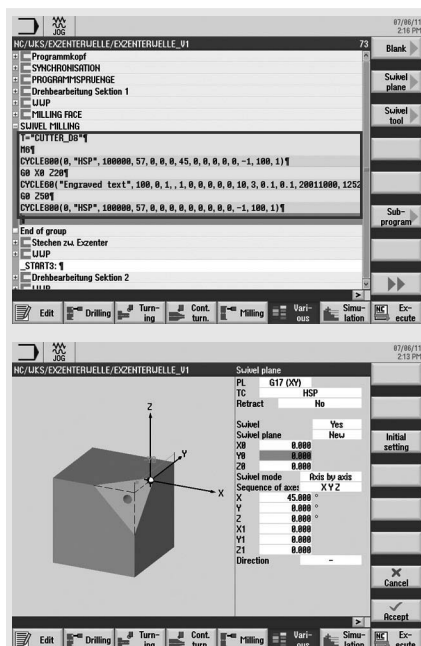

To program on the swiveled plane, use the "Swivel plane" function to select the CYCLE800. In this case, a new machining plane will be created on which you can now create all milling functionality, also with the help of cycles.

5.3 Milling-turning technology with ShopMill and programGUIDE


This section provides an overview of the technology cycles for turning and contour turning with the milling technology. The contour turning is explained using examples in programGUIDE and ShopMill. To check the programming, you can also use the “Simulation” function for the milling-turning.

5.3.1 TSM-mode



For a selected and active turning tool, in the TSM-mode, you can know position/approach the turning tool (tool alignment with swiveling axes). When selecting a turning tool, the machine is switched over into the turning mode.

5.3.2 Tool measuring

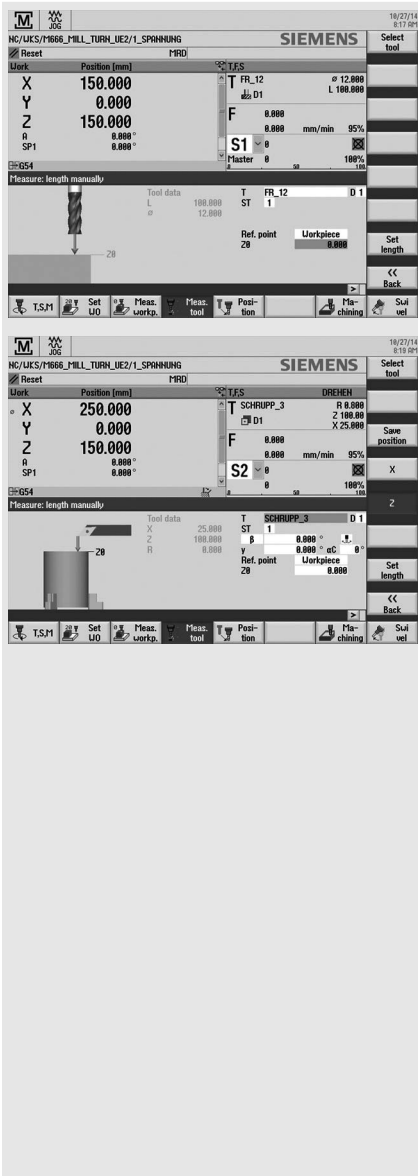

You can measure turning tools in milling-turning technology. The screen form changes depending on the tool type to be measured.

The turning tools can be measured when approached/positioned.

5.3.3 Face milling/stock removal



 Machining

 Face milling

OR


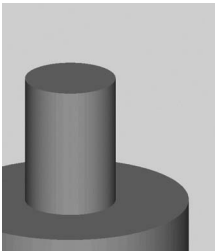
 Stock removal

In the Machine operating area, under the “Machining” softkey, you can select between “Face milling” and “Stock removal” across technologies.


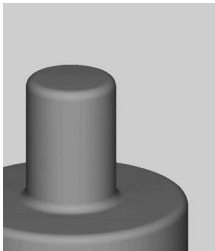
5.3.4 Overview of the turning cycles in the milling technology

An overview of the turning cycles with application tips follows.


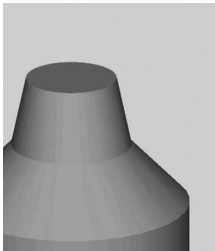
Stock
removal



Cycle for turning a shoulder or, for example, for simple face turning




Cycle for turning a shoulder with corner rounding or chamfers




Cycle for turning a conical shoulder with optional corner rounding or chamfers


Groove

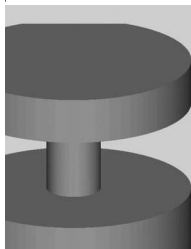

Grooving cycle with-
out rounding

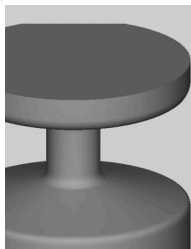


Extended grooving
cycle with optional
rounding or chamfers
and additional
conicity

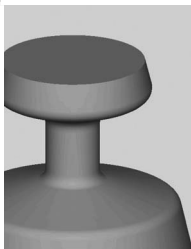


Extended grooving
cycle on conical
turned parts


Undercut

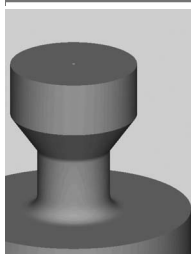


Cycle for external or
internal undercuts
according to the
standard E

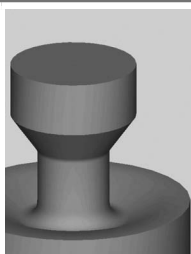

Cycle for external or
internal undercuts
according to the
standard F

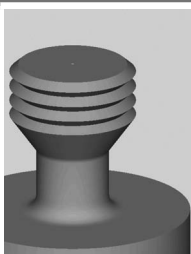

Cycle for external or
internal thread
undercuts according
to the DIN standard

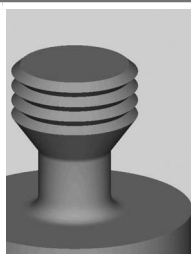


Cycle for external or
internal thread
undercuts without
any standard (freely
programmable)

Thread



Thread long.

Thread cycle for longitudinal thread

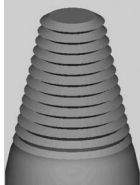

Thread taper

Thread cycle for tapered threads



Thread face


Thread cycle for face thread



Thread chain

Thread cycle for chaining different threads in a single operation

Cutoff


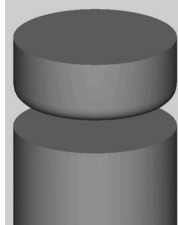


Cycle for parting rod parts

5.3.5 Contour turning in the milling technology

This section provides an overview of the cycles for contour turning in the milling technology. The contour turning with programGUIDE and Shopmill is explained as an example.


5.3.5.1 Overview of the contour turning cycles

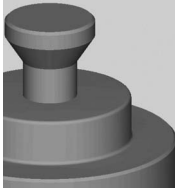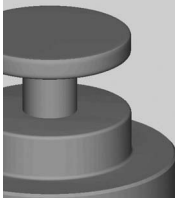Stock removal → or Cut resid. stock →	
	Stock removal cycle for machining any contours with the stock removal technology; it can be combined with automatic residual material detection
Grooving → or Groove resid. →	
	Plunge-turning cycle for machining any contours with the plunge-turning technology; it can be combined with automatic residual material detection

Plunge
turning

or

Plunge
turn.resid.

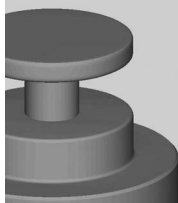

Plunge-turning cycle
for machining any
contours with the
plunge-turning
technology; it can be
combined with
automatic residual
material detection

5.3.5.2 Contour turning with programGUIDE in the milling technology

The contour call and calls of the stock removal and residual stock removal cycles are explained using the following example program.

08/17/15
10:02 AM

Lokal. Laufw./MY_OPERATE/TURNING1

1. N1 CYCLE800(0, "DREHEN", 200, 57, , , , 0, 0, , , -1, , 2)¶
N2 G54¶
2. N3 WORKPIECE(, "", , "CYLINDER", 64, 5, -100, -80, 250)¶
N4 T="0816"D1¶
N5 M6¶
3. N6 CYCLE800(0, "DREHEN", 200, 57, , , , 0, 0, 0, , , 1, , 2)¶
N7 DIAMON¶
N8 LIMS=700¶
N9 G0 X255 Y0 Z5 G96 S200 M4¶
4. N10 CYCLE62("FERTIG", 1, , ,)¶
5. N11 CYCLE952("FERTIG", , "", 103112, 0.35, , 0, 5, 0.1, 0.1, 0, 0, 0.1, 0, 1, 255, 3, , , ,
N12 CYCLE800()¶
N13 M30¶
6. N14 E_LAB_A_FERTIG: ; #SM Z: 3¶
G18 G90 DIAM90; *GP*¶
G0 Z0 X162 ; *GP*¶
G1 X160 RND=1 ; *GP*¶
Z-10 RND=.3 ; *GP*¶
X154 RND=.3 ; *GP*¶
Z-22 X130 RND=1 ; *GP*¶
Z-24 ; *GP*¶

Edit Drilling Milling Cont. mill. Turning Various Simulation NC Execute

1. Zero swivel


2. Blank input

3. Align turning tool

4. Contour call

5. Stock removal along contour

6. Contour description

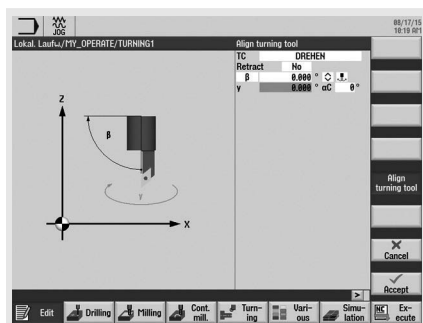

Various


Swivel tool

Align turning tool

The “Align turning tool” function provides support for the milling/turning centers with multi-axis kinematics. The position and orientation of the turning tool can be changed by rotating the swivel axis (β angle) and rotating at the tool axis (γ angle).

You have the following ways of including a contour call in a programGUIDE program:

The contour is contained in the main program directly behind M30	<div style="background-color: #333; color: white; padding: 2px 5px; font-weight: bold;">Contour call</div> <div style="border: 1px solid #ccc; padding: 5px; margin-top: 5px;"> <div style="background-color: #eee; padding: 2px 5px; font-weight: bold;">Contour name</div> <div style="border-top: 1px solid #ccc; padding-top: 5px;">CON</div> </div>
The contour is contained in a subroutine	<div style="background-color: #333; color: white; padding: 2px 5px; font-weight: bold;">Contour call</div> <div style="border: 1px solid #ccc; padding: 5px; margin-top: 5px;"> <div style="background-color: #eee; padding: 2px 5px; font-weight: bold;">Subprogram</div> <div style="border-top: 1px solid #ccc; padding-top: 5px;">PRG</div> </div>
The contour is contained in the main program between two labels	<div style="background-color: #333; color: white; padding: 2px 5px; font-weight: bold;">Contour call</div> <div style="border: 1px solid #ccc; padding: 5px; margin-top: 5px;"> <div style="background-color: #eee; padding: 2px 5px; font-weight: bold;">Labels</div> <div style="border-top: 1px solid #ccc; padding-top: 5px;">LAB1</div> <div style="border-top: 1px solid #ccc; padding-top: 5px;">LAB2</div> </div>
Call using labels in a subroutine	<div style="background-color: #333; color: white; padding: 2px 5px; font-weight: bold;">Contour call</div> <div style="border: 1px solid #ccc; padding: 5px; margin-top: 5px;"> <div style="background-color: #eee; padding: 2px 5px; font-weight: bold;">Labels in subprogram</div> <div style="border-top: 1px solid #ccc; padding-top: 5px;">PRG</div> <div style="border-top: 1px solid #ccc; padding-top: 5px;">LAB1</div> </div>

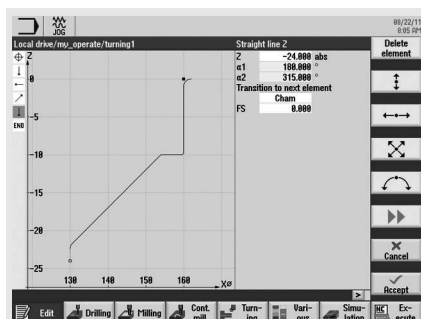


First insert the contour call at the desired location in the program. Note the above figure for contour calls.



Create a new contour in the contour calculator.

- Create a new contour in the contour calculator.


- **Note:** Contours can be renamed.

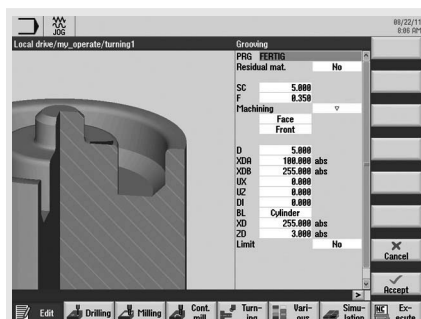


Enter for grooving the name of a program to be generated (PRG). The program names can be chosen freely.

During the program execution, the G codes for the stock removal or the milling of contour elements using CYCLE952 (contour turning) or CYCLE63 (contour milling), including the residual material removal, will be generated in the programs described above. Since these are normal NC programs, you can continue to use them, for example, to use the calculated code for a cycle-free and thus faster program.


5.3.5.3 Contour turning with ShopMill when milling

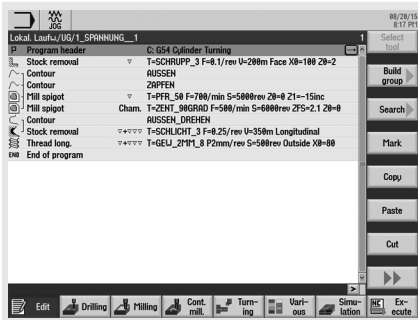

Contour turning with ShopMill in the milling technology is explained with the following example.

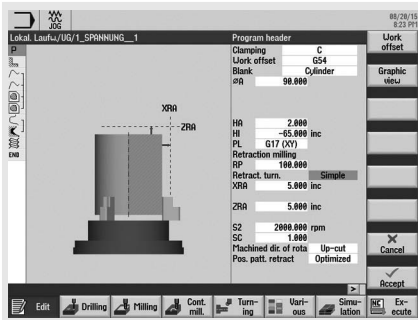


In the program header, you define the program parameters, such as blank and zero offset. In addition, you enter specific parameters for turning operations, for example, turning retraction plane, max. turning spindle speed.

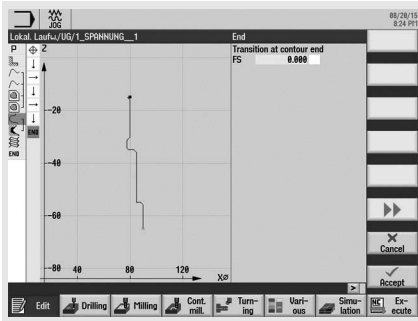

Define a new contour in the contour calculator.

■ You can enter as many as 256 geometric elements.

■ **Note:** Contours can be renamed.

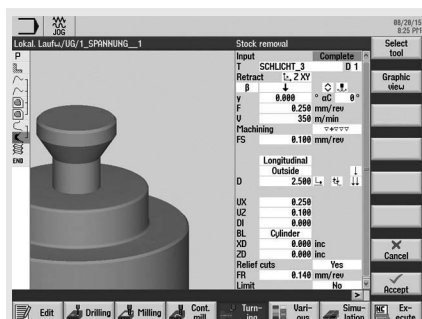

During cutting und residual material machining, you can select, for example, the following settings:

- Do not track tool tip when swivelling
- Align cut segmentation to edges
- Constant cutting depth

5.4 Multi-channel machining

You can use programSYNC to easily synchronize and visualize multi-channel machining. To this end, proceed as follows:

- Create the structure of the part programs with the help of blocks
- Program the individual machining steps
- Simulate the part programs
- Load the part programs (for each channel or spindle)

The following sections describe the programming under programSYNC.


5.4.1 Machine basic screen




You can choose between a one- or two-channel view as machine basic screen.

The active channel is color-highlighted for the two-channel view.

5.4.2 programSync multi-channel

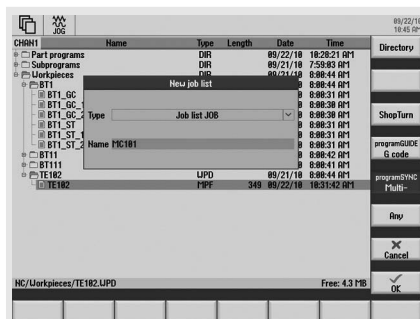

To structure multi-channel programs, use the “programSync multi-channel” softkey to create a job list.

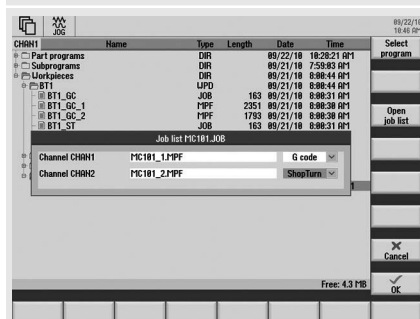


You can then assign any ShopTurn or G code programs to the appropriate channels.



To edit the assigned programs, open the job list (*.JOB) in the program manager. The programs open together in the dual editor.

5.4.3 Multi-channel program data

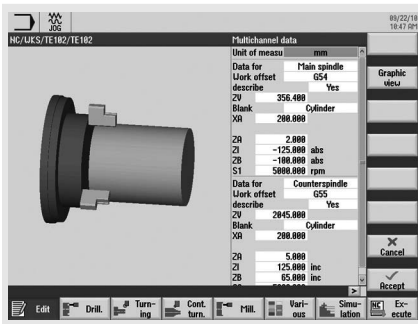

Edit

Open the program header in the editor.


The program header shows a standard over-view of the multi-channel data for both ShopTurn and programGUIDE.

5.4.4 Dual editor



Edit

The dual editor supports you for the concurrent creation of the programs for both channels.

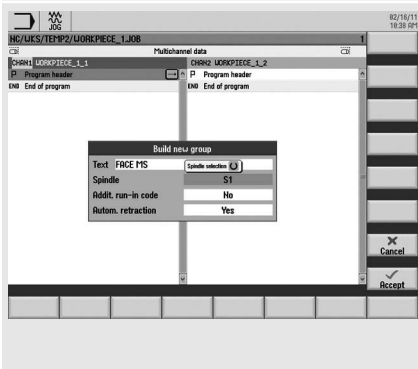


Edit



Build group

The block generation is the basis of the multi-channel programming.

Generate the program structure with the help of blocks. Then enter the appropriate program code within the respective blocks.

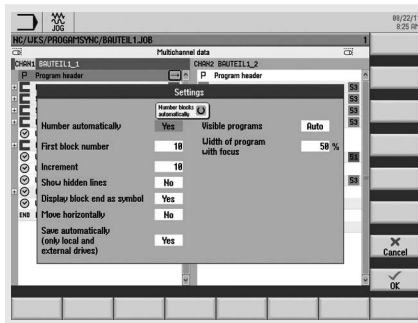


Edit



Settings

You can configure the editor. You can specify how many programs should be visible, etc.


5.4.5 Time synchronization

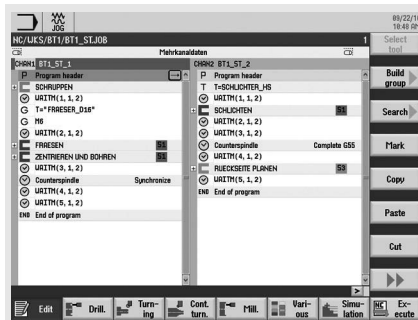


Edit

You can insert wait markers for the chronological matching of the machining blocks in the various channels, e.g. WAITM(1,1,2).

WAITM(1,1,2)

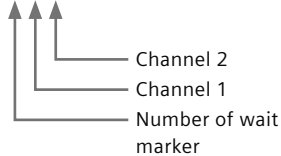

5.4.6 Synchronous view

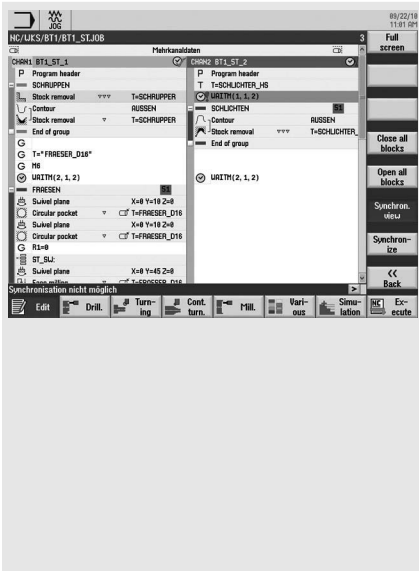


You can use the “Synchronous view” function to check the wait markers.

The wait markers are compared with each other to produce a clear program presentation.



The result is visualized:

- ☒ Without conflict/fault
- ☒ Conflict/fault

5.4.7 Simulation

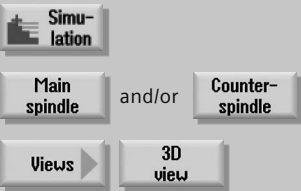

3D simulation with 3-level view and volume model of the finished part.

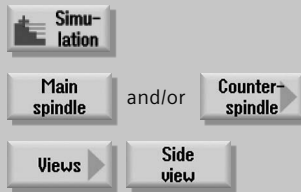
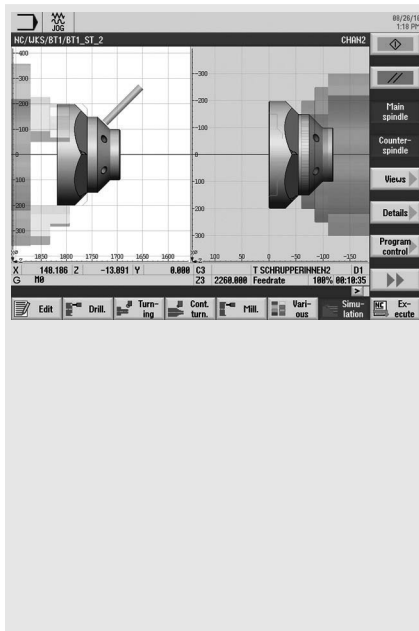


Simulation in the side view.




You can also use the simultaneous recording function in Automatic mode.

5.4.8 Determining the machining time, optimization

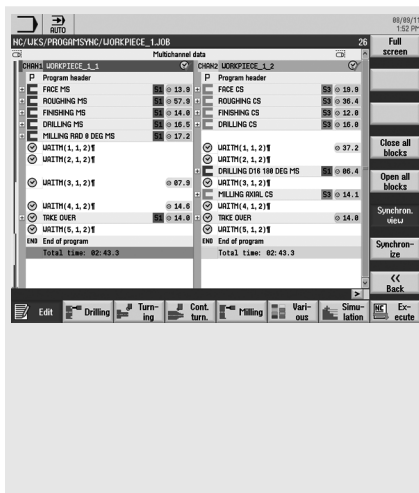

After a successful simulation, the system determines the execution time of the machining steps. This allows you to optimize the channels with each other.

5.4.9 Program control

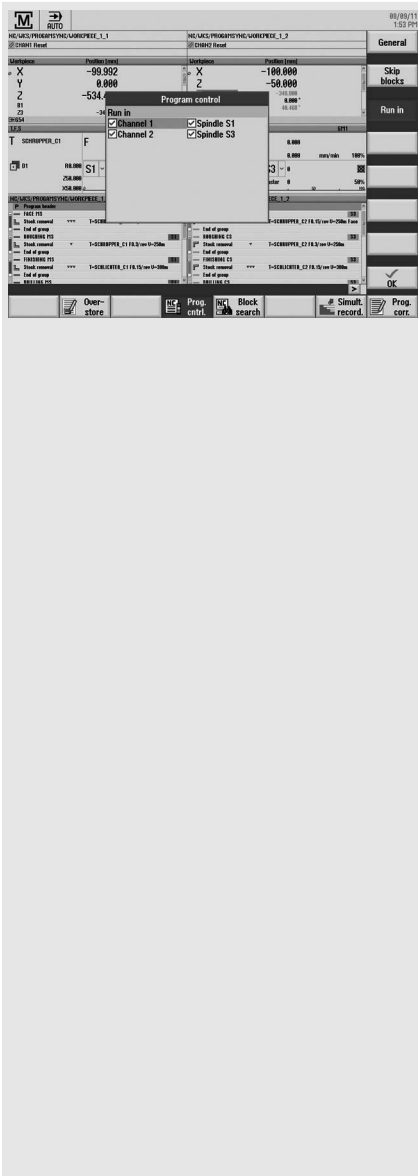

In Automatic mode, you can choose between different approach variants - by channel or by spindle.

6 Appendix

6.1 G-Code

- **G code**

G-code according to DIN66025 and in ISO dialect mode

- **G Functions**

G0, G1, G2, G71 ...

- **Language commands (extended G functions)**

CIP, SOFT, FFWON ...

- **Frame operations (programmable work offsets)**

The workpiece coordinate system can be shifted, scaled, mirrored or rotated with the commands TRANS, SCALE, MIRROR, ROT.

- **User variables**

The user can define his own variables by name and type.

- **System variables**

System variables can be read/written in all programs. They enable access to work offsets, tool offsets, axis positions, measured values, controller states, etc.

- **Arithmetic operations**

Arithmetic operations are available to combine the variables:



















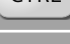









- Computational operations + - * / sin cos exp etc.
- Logical operations == <> >= etc.

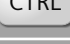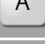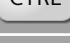- **Program control structures**










BASIC-style language commands are available for flexible programming of the user cycles: IF-ELSE-ENDIF, FOR, CASE ...Shortcuts

6.2 Shortcuts








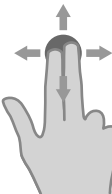


Functions – Shortcut keys

Control key:	
 + 	For screenshots – Storage location: Commissioning (password) – System data – HMI data – Logs – Screenshots
 + 	Language switchover
 + 	Copy
 + 	Cut
 + 	Paste
 + 	Redo (editor functionality)
 + 	Undo – max. 50 steps in the editor (editor functionality)
 + 	Select all (editor functionality)
 + 	Go to start of program
 + 	Go to end of program
 +  + 	Save complete archive – NCK/PLC/drives/HMI
 +  + 	Backup log files on USB or CompactFlash card
 + 	Control energy

	Maximum simulation speed
	Search in all screen forms Wildcards "?" and "*" can be used in search screen forms. "?" stands for any character, "*" for any number of any characters.
	Switchover to graphic view when programming
	Calculation of the time from/to line/block
Miscellaneous:	
	Commenting out of cycles and direct editing of programGUIDE cycles
	Select up to end of block
	Select up to start of line
	Jump to start of line
	Enter Asian characters
	Calculator function
	Help function
	Open the directory tree in the Program Manager
	Jump to end of line

Simulation and simultaneous recording:	
	Move
	Rotate in 3D display
	Move section
	Override +/- (simulation)
	Single block on/off (simulation)
Insert key:	
	It brings you into the Edit mode for text boxes or into the Selection mode of combo boxes and toggle fields. You can exit this without making any changes by pressing Insert again.
	Undo function, as long as no Input key is pressed or no data has already been transferred to the fields.
Toggle key:	
	You can directly switch between toggle fields using the Toggle key (Select) without having to open them. With Shift-Toggle you can switch through these in the reverse direction.
Cursor key:	
	Open/close directory Open/close program Open/close cycle

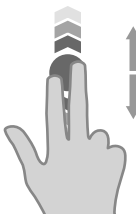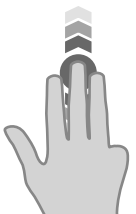6.3 Gesture control – Smart Operate

	Tap Select window Select object (e.g. NC block)		Tap with two fingers Call context menu (e.g. copy, paste)
	Tap and hold Open object for changing (e.g. NC block)		Flick Scroll in lists (e.g. programs or tools, zero points) Scroll in files (e.g. NC programs)
	Flick with two fingers Page-scrolling in lists (e.g. NPV) Page-scrolling in files (e.g. NC programs)		Flick with three fingers Scroll to the start or end of lists Scroll to the start or end of files
	Pan Move graphic contents (e.g. simulation, mold making view)		Pan with two fingers Rotate graphic contents (e.g. simulation, mold making view)
	Pinch Zoom-in graphic contents (e.g. simulation, mold making view)		Spread Zoom-out graphic contents (e.g. simulation, mold making view)

6.4 Further information

CNC equipment of SINUMERIK

www.siemens.com/sinumerik
<<http://www.siemens.com/sinumerik>>

Doconweb

www.automation.siemens.com/doconweb
<<http://www.automation.siemens.com/doconweb>>

CNC4you - User portal

www.siemens.com/cnc4you
<<http://www.siemens.com/cnc4you>>

SINUMERIK - User forum

www.siemens.cnc-arena.com
<<http://www.siemens.cnc-arena.com>>

CAD/CAM from Siemens

www.siemens.com/plm
<<http://www.siemens.com/plm>>

7 Index

Aligning milling tool		
Multitasking machines.....	144	
Aligning turning tool		
Multitasking machines.....	142	
Animated elements	16	
Blank	128	
Block search	49	
Boring.....	114	
Centering.....	69, 113	
Centric drilling.....	68	
Collision Avoidance	54	
Contour call programGUIDE		
Contour milling	96, 126	
Contour turning	83, 155	
Contour milling		
programGUIDE	125	
ShopMill	123	
Contour turning		
programGUIDE	154	
Counterspindle.....	98	
Cutoff	78, 151	
Cutting	76, 149	
Cycles		
Parameters.....	37	
technological scaling	38	
Variables.....	37	
Cylinder jacket.....	134	
Deep hole drilling	70, 114	
Drilling Reaming.....	69, 113	
Drilling with programGUIDE	74	
Drilling with ShopTurn		
centered/off center.....	73	
Dual editor		
programSYNC.....	162	
DXF Reader	39	
automatic clean-up.....	41	
contour calculator	40	
import element	42	
import from DXF	40	
layer selection	41	
position pattern	44	
Program Manager.....	39	
select element.....	42	
starting point	42	
Editor		
Open second program	34	
Search	36	
Settings	34	
Settings multi-channel.....	163	
Engraving	90, 120	
Execution from External Storage		
(EES).....	45	
Face milling.....	106, 117	
Gesture control		
Smart Operate.....	173	
Graphic view	16	
Groove	77, 150	
Help		
context-sensitive	17	
Help Screen.....	16	
High Speed Settings		
Advanced Surface.....	130	
Top Surface.....	131	
in-process measurement.....	99, 135	

Workpiece measurement – alignment workpiece probe.....	136, 137	programGUIDE create G code.....	29
Machine basic screen		Properties	30
Multi-channel machining	160	Save setup data.....	31
Machining time		Programming	
programSYNC.....	165	Form blocks	36
Machining times.....	34	ISO code	33
Manual Machine		programGUIDE	33, 112
Milling	108	programSYNC.....	33
Turning.....	62	ShopMill	110
Measuring cycles		ShopMill/ShopTurn	33
Example.....	100	split up blocks	37
Overview	99, 135	subprogram	35
Mirroring.....	134	Syntax Highlighting	36
Mold making view	47	programSYNC.....	160
Multi-channel program data.....	162	Dual editor.....	162
Multiple clamping.....	32	Job list JOB.....	161
Offset	133	Machining time	165
Open job list.....	161	program control	166
Path milling		Simulation	164
Contour	91, 121	Synchronous view	164
Plunge-cutting		Time synchronization	163
Contour	79, 152	Wait marks.....	163
Plunge-turning		Recording of measurement results	
Contour	80, 153	AUTO	52
Pocket.....	88, 118	JOG	19
Contour	92, 122	Retraction	22
Positions	72, 116	Rotation	133
Program control		Rough drill	91, 121
programSYNC.....	166	Scaling	134
Program management	29	Settings	
Create archive	31	Editor.....	34
Create directory.....	29	Editor multi-channel.....	163
Create ShopMill/ShopTurn program.		Set ZO.....	18, 58, 104
29		ShopMill	
Create tool	29	Program header	109
DXF Reader	30	ShopTurn	
*.jpg, *.png, *.bmp.....	30	Program header	64
PDF.....	30	Simulation	
Preview	30	programSYNC.....	164
		Simultaneous recording	50

Slot.....	89, 119	Transformation.....	133
Spigot		TSM cycle.....	18
Contour	92, 122	TSM-mode	
Spigot polyhedron	89, 119	Swivel axis	141
Stock removal		Undercut.....	77, 150
Contour	79, 152	User variables.....	28
Swivel		Wait marks	
Plane	107	programSYNC.....	163
Swivel axis		Workpiece zero.....	59, 105
TSM-mode	141	Zero offset	27, 133
Swivel plane			
Multitasking machines.....	143, 145		
Synchronous view			
programSYNC.....	164		
Technological scaling			
cycles	38		
Thread	71, 78, 115, 151		
Thread milling	90, 120		
Time synchronization			
programSYNC.....	163		
Tool			
Favorites.....	25		
Multitool.....	25		
Search	25, 26		
Tool list.....	23		
Details	23		
Sister tool	23		
Tool management			
Multitasking machines.....	140		
Multitools	140		
Tool measurement			
Counterclamping holder	60		
JOG	59, 106		
Tool probe	60		
Tool simulation			
3D	46		
Cross-section.....	47		
Details	46		
Tooltip	17		
Tool wear.....	24		

CNC equipment of SINUMERIK

www.siemens.com/sinumerik

Doconweb

www.automation.siemens.com/doconweb

CNC4you - User portal

www.siemens.com/cnc4you

SINUMERIK - User forum

www.siemens.cnc-arena.com

CAD/CAM from Siemens

www.siemens.com/plm

The information provided in this brochure contains descriptions or characteristics of performance which in case of actual use do not always apply as described or which may change as a result of further development of the products. An obligation to provide the respective characteristics shall only exist if expressly agreed in the terms of contract.

All product designations may be trademarks or product names of Siemens AG or supplier companies whose use by third parties for their own purposes could violate the rights of the owners.

Siemens AG

Industry Sector

Motion Control Systems

Postfach 31 80

91050 ERLANGEN

GERMANY

Subject to change without prior notice

Order no.: 6FC5095-0AA84-0BA2

Printed in Germany

© Siemens AG 2015